

Original

TP-00452

TP-00452

NOAA FORM 76-35	
U.S. DEPARTMENT OF COMMERCE NATIONAL OCEANIC AND ATMOSPHERIC ADMINISTRATION NATIONAL OCEAN SURVEY	
DESCRIPTIVE REPORT	
Type of Survey Coastal Boundary	
Job No. PH-7119	Map No. TP-00452
Classification No. Final	Edition No. ... 1
Field Edited Map	
LOCALITY	
State Florida	
General Locality ... Monroe County	
Locality ... Butternut Key to Point	
Lowe	
1972 TO 1975	
REGISTRY IN ARCHIVES	
DATE	

NOAA FORM 76-36A (3-72)		U. S. DEPARTMENT OF COMMERCE NATIONAL OCEANIC AND ATMOSPHERIC ADMIN.	
DESCRIPTIVE REPORT - DATA RECORD		TYPE OF SURVEY ☒ ORIGINAL ☐ RESURVEY ☐ REVISED	
PHOTOGRAMMETRIC OFFICE Rockville, Maryland OFFICER-IN-CHARGE Commander James Collins		SURVEY TP. <u>00452</u> MAP EDITION NO. <u>(1)</u> MAP CLASS <u>Final</u> JOB <u>PH-7119</u>	
PHOTOGRAMMETRIC OFFICE Rockville, Maryland OFFICER-IN-CHARGE Commander James Collins		LAST PRECEDING MAP EDITION TYPE OF SURVEY ☐ ORIGINAL ☐ RESURVEY ☐ REVISED JOB <u>PH-</u> MAP CLASS <u></u> SURVEY DATES: 19 <u></u> TO 19 <u></u>	
I. INSTRUCTIONS DATED			
1. OFFICE General Instructions-OFFICE-NOS Cooperative Coastal Boundary Mapping, Job PH-7000 December 9, 1975 Supplement I, November 4, 1974 Supplement III, October 24, 1974 NOTE: Office & field edit instructions (1975) incorporate applicable prior operational instructions.		2. FIELD Aerial Photography 9/2/69 Supplement I, 1/28/70 Supplement II, 3/26/70 Supplement III, 8/10/72 Field Edit (PH-7000 General Instruc- tions for Florida Coastal Zone Mapping) 1973	
II. DATUMS			
1. HORIZONTAL: ☒ 1927 NORTH AMERICAN		OTHER (Specify)	
2. VERTICAL: ☒ MEAN HIGH-WATER ☒ MEAN LOW-WATER ☐ MEAN LOWER LOW-WATER ☐ MEAN SEA LEVEL		OTHER (Specify) Mean water level Refer 76-36 B-1: Remarks	
3. MAP PROJECTION Transverse Mercator		4. GRID(S) STATE <u>Florida</u> ZONE <u>East</u> STATE <u></u> ZONE <u></u>	
5. SCALE 1:10,000		STATE <u></u> ZONE <u></u>	
III. HISTORY OF OFFICE OPERATIONS			
OPERATIONS		NAME	DATE
1. AEROTRIANGULATION BY METHOD: Analytic LANDMARKS AND AIDS BY		V. McNeel	6/74
2. CONTROL AND BRIDGE POINTS PLOTTED BY METHOD: Coradamat CHECKED BY		R. Robertson	1/75
3. STEREOSCOPIC INSTRUMENT PLANIMETRY BY COMPILATION CHECKED BY		Inapplicable	
INSTRUMENT: CONTOURS BY SCALE: CHECKED BY		Inapplicable	
4. MANUSCRIPT DELINEATION PLANIMETRY BY METHOD: Graphic CHECKED BY SCALE: 1:10,000 HYDRO SUPPORT DATA BY CHECKED BY		P. Gibson	4/75
		C. Lewis	4/75
		Inapplicable	
		Inapplicable	
5. OFFICE INSPECTION PRIOR TO FIELD EDIT BY		J. Battley D. Brant	4/75
6. APPLICATION OF FIELD EDIT DATA BY		J. McClure	10/75
		J. Battley	12/75
7. COMPILATION SECTION REVIEW BY		J. Battley	12/75
8. FINAL REVIEW BY		D. Brant	6/75
9. DATA FORWARDED TO PHOTOGRAMMETRIC BRANCH BY			
10. DATA EXAMINED IN PHOTOGRAMMETRIC BRANCH BY		D. Brant	8/76
11. MAP REGISTERED - COASTAL SURVEY SECTION BY		R.T. CATRK	9/76

NOAA FORM 76-36B
(3-72)U. S. DEPARTMENT OF COMMERCE
NATIONAL OCEANIC AND ATMOSPHERIC ADMINISTRATION
NATIONAL OCEAN SURVEY

TP-00452

COMPILATION SOURCES

1. COMPILATION PHOTOGRAPHY

CAMERA(S) WILD RC-8 K&L Camera 6" focal length		TYPES OF PHOTOGRAPHY LEGEND		TIME REFERENCE	
TIDE STAGE REFERENCE		(C) COLOR IR (P) PANCHROMATIC (I) INFRARED B&W		ZONE Eastern	☒ STANDARD
☐ PREDICTED TIDES ☐ REFERENCE STATION RECORDS ☒ TIDE CONTROLLED PHOTOGRAPHY				MERIDIAN 75th	☐ DAYLIGHT
NUMBER AND TYPE	DATE	TIME	SCALE	STAGE OF TIDE	
73L(C) 2965-2968R 73L(C) 2792-2794R	3/18/73 3/5/73	1045 1918	1:40,000 1:40,000	The stage of tide is inapplicable for the color photography.	
72K6326R-6330R 72K6378R-6379R 72K6504R6505R	2/14/72 2/14/72 2/16/72	1300 1412 1103	1:30,000 1:30,000 1:30,000		
Refer to the following page for tidal information.					

REMARKS

2. SOURCE OF MEAN HIGH-WATER LINE:

The source of the MHW line (Atlantic Ocean) is the tide-coordinated, black-and-white infrared photography listed under item 1.

The source of the MWL line (Interior Waters) is the black-and-white, tide-coordinated infrared photography listed under item 1. Refer to 76-36 B 1 Remarks for explanation of MWL datum.

Where the MHW line or the MWL line is obscured by vegetation, such as mangrove, the apparent shoreline symbol was used.

3. SOURCE OF MEAN LOW-WATER OR MEAN LOWER LOW-WATER LINE:

The source of the MLW line (Atlantic Ocean) is the tide-coordinated infrared photography listed under item 1.

4. CONTEMPORARY HYDROGRAPHIC SURVEYS (List only those surveys that are sources for photogrammetric survey information.)

SURVEY NUMBER	DATE(S)	SURVEY COPY USED	SURVEY NUMBER	DATE(S)	SURVEY COPY USED
Inapplicable					

5. FINAL JUNCTIONS

NORTH No contemporary Survey	EAST TP-00453	SOUTH TP-00454	WEST No contemporary survey
---------------------------------	------------------	-------------------	--------------------------------

REMARKS

Final junctions were made in the Coastal Mapping Section

NOAA FORM 76-36B(1)
(7-75)U. S. DEPARTMENT OF COMMERCE
NATIONAL OCEANIC AND ATMOSPHERIC ADMINISTRATION
NATIONAL OCEAN SURVEY

TIDE - COORDINATED PHOTOGRAPHY

TP - 00452

LOCATION AND PHOTOGRAPHY	TIDE STATIONS (In operation at time of photography)	STAGE OF TIDE	MEAN RANGE
<u>FLORIDA BAY</u>			<u>AT TIDE STATION</u>
72K 6326R - 6330R	Tavernier, Florida Bay	+0.18MWL	- -
72K6378R - 6379R	Tavernier, Florida Bay	+0.16MWL	- -
72K6504R - 6505R	Tavernier, Florida Bay	+0.20MWL	- -
<u>ATLANTIC OCEAN</u>			
72K6378R - 6379R	Tavernier, Hawk Channel	+0.13MLW	2.13'
72K6504R - 6505R	Tavernier, Hawk Channel	+0.10MHW	

REMARKS: The periodic tide on TP-00452 (west of Route 1) was masked by non-tidal forces and the mean range was substantially less than two-tenths of a foot. In this situation the mean high/low water datums converge, and for mapping purposes, the mean high and low water lines are indistinguishable. As a consequence, special treatment was given to the portrayal of the shoreline on this map: the mean water level line was mapped in lieu of the mean high water line and shown by a distinctive symbol.

HISTORY OF FIELD OPERATIONS

TP-00452

I. ☒ FIELD INSPECTION OPERATION * Feb. 1972 ☒ FIELD EDIT OPERATION Aug. 1975
Mar.

OPERATION	NAME	DATE
1. CHIEF OF FIELD PARTY	R. R. Wagner	
2. HORIZONTAL CONTROL	RECOVERED BY R. R. Wagner	8/75
	ESTABLISHED BY Inapplicable	
	PRE-MARKED OR IDENTIFIED BY Inapplicable	
3. VERTICAL CONTROL	RECOVERED BY R. R. Wagner	8/75
	ESTABLISHED BY Inapplicable	
	PRE-MARKED OR IDENTIFIED BY R. R. Wagner	8/75
4. LANDMARKS AND AIDS TO NAVIGATION	RECOVERED (Triangulation Stations) BY R. R. Wagner	8/75
	LOCATED (Field Methods) BY R. R. Wagner	8/75
	IDENTIFIED BY Inapplicable	
5. GEOGRAPHIC NAMES INVESTIGATION	TYPE OF INVESTIGATION ☐ COMPLETE ☐ SPECIFIC NAMES ONLY ☒ NO INVESTIGATION	
6. PHOTO INSPECTION	CLARIFICATION OF DETAILS BY R. R. Wagner	8/75
7. BOUNDARIES AND LIMITS	SURVEYED OR IDENTIFIED BY Inapplicable	

II. SOURCE DATA

1. HORIZONTAL CONTROL IDENTIFIED		2. VERTICAL CONTROL IDENTIFIED	
PHOTO NUMBER	STATION NAME	PHOTO NUMBER	STATION DESIGNATION
	Refer to Field Reports	73L2794R	E 276, V 327, X 327
		73L2793R	B 276

3. PHOTO NUMBERS (Clarification of details)

72K6378, 73L2793R, 73L2794R, 73L2966R, 73L2967R

4. LANDMARKS AND AIDS TO NAVIGATION IDENTIFIED

Landmarks and nonfloating aids were either verified or located by field edit.

PHOTO NUMBER	OBJECT NAME	PHOTO NUMBER	OBJECT NAME

5. GEOGRAPHIC NAMES: ☐ REPORT ☒ NONE6. BOUNDARY AND LIMITS: ☐ REPORT ☒ NONE

7. SUPPLEMENTAL MAPS AND PLANS

8. OTHER FIELD RECORDS (Sketch books, etc. DO NOT list data submitted to the Geodesy Division)

8 Pages of sextant cuts.

* The field reports are bound with this Descriptive Report.

NOAA FORM 76-36D
(3-72)U. S. DEPARTMENT OF COMMERCE
NATIONAL OCEANIC AND ATMOSPHERIC ADMINISTRATION

TP-00452

RECORD OF SURVEY USE

I. MANUSCRIPT COPIES

COMPILATION STAGES			DATE MANUSCRIPT FORWARDED	
DATA COMPILED	DATE	REMARKS	MARINE CHARTS	HYDRO SUPPORT
No map copies were furnished to Marine Charts prior to final review.				
			9/9/76	

II. LANDMARKS AND AIDS TO NAVIGATION

1. REPORTS TO MARINE CHART DIVISION, NAUTICAL DATA BRANCH

NUMBER	CHART LETTER NUMBER ASSIGNED	DATE FORWARDED	REMARKS
		11/20/75	Four (4) digitized 76-40 Forms were submitted as final report.

2. ☒ REPORT TO MARINE CHART DIVISION, COAST PILOT BRANCH. DATE FORWARDED: 11/20/753. ☐ REPORT TO AERONAUTICAL CHART DIVISION, AERONAUTICAL DATA SECTION. DATE FORWARDED: _____

III. FEDERAL RECORDS CENTER DATA

1. ☒ BRIDGING PHOTOGRAPHS; ☒ DUPLICATE BRIDGING REPORT; ☒ COMPUTER READOUTS.
 2. ☒ CONTROL STATION IDENTIFICATION CARDS; ☒ FORM NOS 567 SUBMITTED BY FIELD PARTIES.
 3. ☒ SOURCE DATA (except for Geographic Names Report) AS LISTED IN SECTION II, NOAA FORM 76-36C.
 ACCOUNT FOR EXCEPTIONS:

4. ☐ DATA TO FEDERAL RECORDS CENTER. DATE FORWARDED: _____

IV. SURVEY EDITIONS (This section shall be completed each time a new map edition is registered)

SECOND EDITION	SURVEY NUMBER TP - _____ (2)	JOB NUMBER PH - _____	TYPE OF SURVEY ☐ REVISED ☐ RESURVEY MAP CLASS ☐ II. ☐ III. ☐ IV. ☐ V. ☐ FINAL
	DATE OF PHOTOGRAPHY	DATE OF FIELD EDIT	
THIRD EDITION	SURVEY NUMBER TP - _____ (3)	JOB NUMBER PH - _____	TYPE OF SURVEY ☐ REVISED ☐ RESURVEY MAP CLASS ☐ II. ☐ III. ☐ IV. ☐ V. ☐ FINAL
	DATE OF PHOTOGRAPHY	DATE OF FIELD EDIT	
FOURTH EDITION	SURVEY NUMBER TP - _____ (4)	JOB NUMBER PH - _____	TYPE OF SURVEY ☐ REVISED ☐ RESURVEY MAP CLASS ☐ II. ☐ III. ☐ IV. ☐ V. ☐ FINAL
	DATE OF PHOTOGRAPHY	DATE OF FIELD EDIT	

SUMMARY
for
TP-00444 thru TP-00454

Coastal Zone Map TP-00452 is one of eleven (11), 1:10,000 scale (shoreline type) maps in Job PH-7119. These maps will not be published. Interior detail is limited to a narrow zone of planimetry usually back to and including the first road.

A layout of Job PH-7119 (revised since the aerotriangulation operation) will show the location of the individual maps. A copy of this layout is included in this Descriptive Report.

The maps are intended for planning purposes for the State of Florida and for the construction and maintenance of NOS nautical charts.

The area is covered by aerial photography taken in 1972 and 1973 on color and black-and-white infrared film. The infrared film was tide coordinated.

The field operations consisted of the following:

1. Premarking of horizontal control for aerotriangulation.
2. Establishment of tidal datums.
3. Field Edit.

Horizontal control was extended by analytical aerotriangulation method using the STK stereocomparator.

The shoreline and alongshore details were compiled from tide-coordinated, black-and-white infrared photography using a B-8 stereoplotter and/or graphic methods. The rectified color photography was used as an aid in interpreting cultural features and compiling the limits of vegetation. The interior details were compiled from a stereoscopic examination of the color photography without field edit.

All line work is scribed, approved symbols are shown in the marginal data of the map.

A registration copy of each map is prepared. The registration copy shows additional offshore details such as shoal and


shallow lines used by the Marine Chart Division but not required on the Coastal Zone Maps. This copy of the map is labeled "Registration Copy" in the title block.

The following items will be registered in the NOS Archives:

1. A stable base copy of the Registration Copy.
2. The Descriptive Report.

The negative of the Registration Copy is filed in the Reproduction Division.

Field records such as field edit sheets, discrepancy prints, field edit photographs, and other field records are filed in the National Archives.

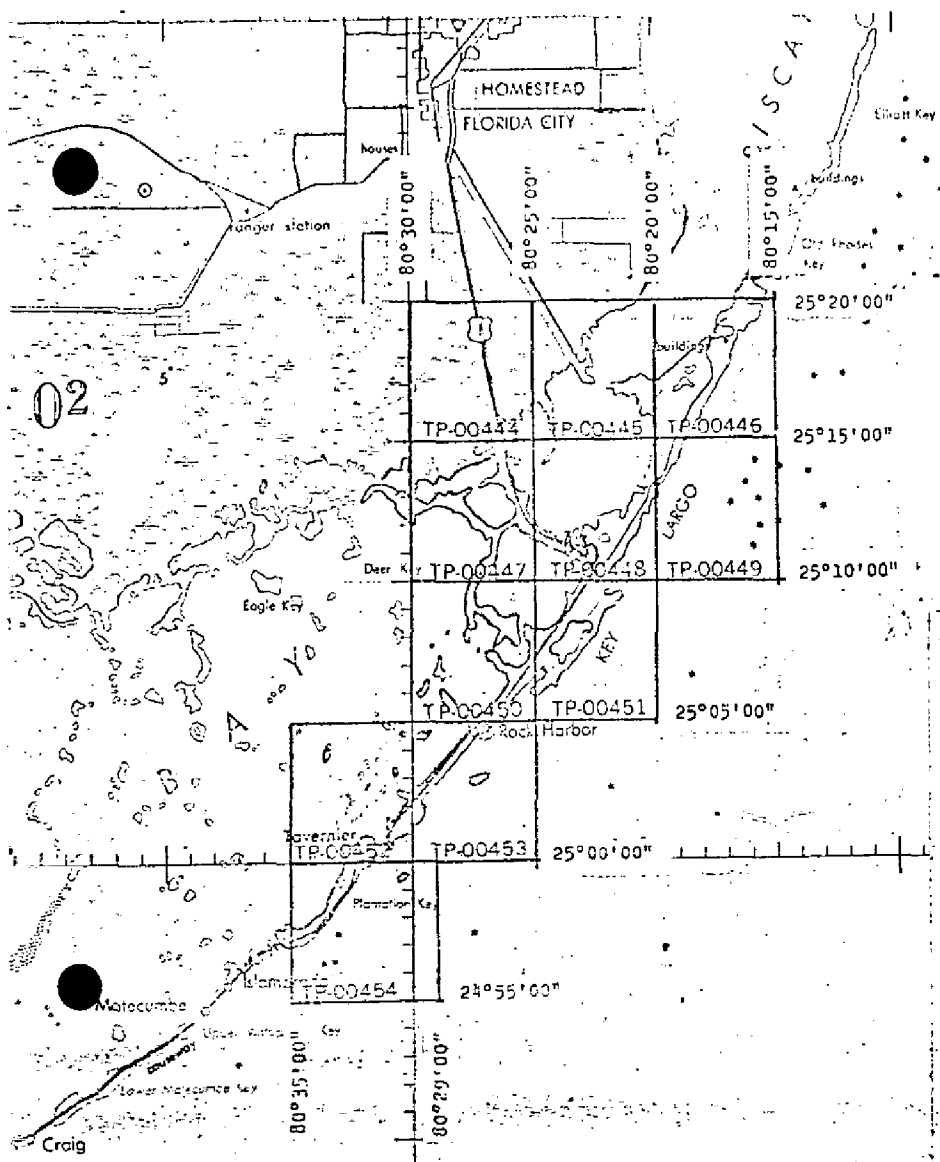

Official Mileage for Cost Accounts	
Sheet No.	Sq. Miles
TP-00444	2
TP-00445	8
TP-00446	6
TP-00447	10
TP-00448	8
TP-00449	2
TP-00450	8
TP-00451	4
TP-00452	4
TP-00453	6
TP-00454	5
Total 63	

JOB PH-7119
 CARD SOUND to PLANTATION KEY
 FLORIDA
 SHORELINE MAPPING
 SCALE 1:10000

REVISED 12/9/75 RWW

80°

FIELD REPORT

JOB PH-7119

This report is on work done in accordance with Instructions-field-Job PH-7119; Horizontal Control for Aerotriangulation and Field Support for Aerial Photography; Coastal Boundary Mapping, Card Sound to Plantation Key, Florida. The field work was done during the period 20 July - 7 September 1971.

1. PREMARKING OF CONTROL

One control station, IRVING 1971, was established on Soldier Key. Eighteen stations were paneled for 1:30,000 scale photography. The deviations from the job diagram and target specifications were recommended in the field by Mr. Saperstein, Photogrammetrist and authorized by the Chief, Surveys Planning Branch. The locations of the paneled stations are shown on the chart section accompanying this report.

2. BRIDGING PHOTOGRAPHY

Flight lines are shown on the accompanying chart. Bridging photography was accomplished on March 8, 1971 for lines 30-4, 30-5, and 30-6 under Job PH-7113. Line 30-6 was redesignated 30-1 for Job PH-7119. Line 20-1 was photographed on Aug. 4 and all other lines on Aug. 11 - the only suitable day in the period 4-26 August. This photography was unacceptable and will be rescheduled for February 1972.

3. TIDE-COORDINATED PHOTOGRAPHY

Locations of the tide staffs are shown on the accompanying chart. Lines 30-4 and 30-5 carried over from Job PH-7113 were completed. Lines 20-2 and 30-3 (Outside) were also completed. Clouds throughout the period prevented completing all lines and the job except for 30-4 and 30-5 will be rescheduled for February 1972. The times are summarized below in case the pictures will be used to supplement the future February work.

Recordings entered in the tide volumes, Form 277, were at 5 minute intervals during photography and at 15 minute intervals near photography. Tolerances of ± 0.3 ft. for MHW and ± 0.1 ft. for MLW were observed. Wet staff readings - crest, mean, and trough - were recorded while photography was in progress. Eastern Standard Time was used.

Line 30-4. Flown for MHW on March 2, 1971 at 1319-1325 when both MIAMI BISCAYNE BAY and CUTLER were in range. The north end

was flown for MLW at 1325-1335 on August 6 when the MIAMI DISCAYNE PAY staff read 2.3 and 2.2. The south end was flown for MLW at 1425-1435 on August 6 when the CUTLER staff read 2.75 and 2.69.

Line 30-5. MHW North half flown at 805-815 on August 7 when CUTLER staff read 4.5 to 4.7. South half flown at 1220-1235 on August 7 when the TURKEY POINT staff read 3.15 to 3.05. MLW North half was flown at 1430-1435 on 6 August when the CUTLER staff read 2.73 to 2.69. South half flown at 850-855 on August 11 when the TURKEY POINT staff read 1.65. This was flown at a reduced altitude of 14,000 feet to get under some clouds. A triplicate was flown at 855-900 to get outlying islands which might not have been covered at the reduced altitude.

Line 20-2. MHW The northern two-thirds were flown at 802-815 on August 9 when the OCEAN REEF staff read 4.58 to 4.70. The remainder was flown at 830-840 on August 10 when the staff read 4.25 to 4.35. MLW Due to clouds this was flown in three parts. The NE end to the Ocean Reef Club was flown at 1328-1342 on August 7 when the staff read 2.25 to 2.11, the Ne end was flown at 1530 on August 6 when the staff read 2.2, and the south part flown at 955-1001 on 16 August when the staff read 2.30.

Line 30-3 (Outside) MHW Flown at 939-947 on August 11 when the TAVERNIER HAWK CHANNEL staff read 4.00 to 4.12, MLW Flown at 1315-1322 on August 4 when the staff read 2.1.

Line 30-3 (Inside) No photography. Clouds and seasonal high tides during the rest of the period prevented it.

Line 20-1. MHW No photography. MLW Line was flown at 927-945 on August 16 when the RAGGED KEYS staff read 1.8 to 1.75.

Line 30-1. MHW The middle third was flown at 1020-1025 on August 4 when the CARD SOUND staff read 3.7 and the MANATEE CREEK staff read 3.5. The remainder was flown at 1110-1115 the same day when the CARD SOUND staff read 3.6 and the MANATEE CREEK staff read 3.5. MLW No photography.

Line 30-2. Line was flown at 835-842 on August 9 when the CARD Sound staff read 3.6 and the MANATEE CREEK staff read 3.75. Line was unacceptable because of clouds in the middle segment and possible smoke in the northern third. This and the MLW photography were not accomplished due to clouds and seasonal high water.

4. ADDITIONAL PHOTOGRAPHY

Tide coordinated photography was taken on a small shoal about one

mile NNE of the Molasses Reef light. The shoal was photographed at about 0900 on August 10 when the TAVERNIER HAWK CHANNEL staff was in MHW range. It was flown at 1206 on August 16 when the staff read 2.31. This shoal was also photographed in color and false color, but the times were not obtained from the photographer.

5. FORESHORE PROFILES

Four planetable beach profiles were run within the limits of the job by Mr. Dale Fuller during the photography period. A brief report accompanies the profile sheet.

6. FIELD RECORDS

All CSI cards, recovery notes, profiles and the original field records for IRVING 1971 were forwarded to C3413 on 1 March 1972. Form 277, Tides Volumes for the MIAMI BISCAYNE BAY, TURKEY POINT, and CUTLER Tide staffs were also forwarded on 1 March. The 277's for the other staffs will be forwarded with the report for the February 1972 photography.

Submitted 29 February 1972

John C. Veselenak

John C. Veselenak
Chief, Photo Party 65

FIELD REPORT

JOB PH-7119

This report is on work done in accordance with Instructions-Field-Job PH-7119; Horizontal Control for Aerotriangulation and Field Support for Aerial Photography; Coastal Boundary Mapping, Card Sound to Plantation Key, Florida, dated January 31, 1972. The field work was done during the period 7-23 February 1972.

1. PREMARKING OF CONTROL

Four stations were paneled for 1:30,000 scale photography. The locations are shown on the chart section accompanying this report.

2. AEROTRIANGULATION PHOTOGRAPHY

Flight lines are shown on the chart. Color photography was accomplished on February 19, 1972 between the approximate times of 1045 and 1230 hours. The skies were exceptionally clear for this area and the ground winds was from the northwest at 20-25 knots all morning. These lines were also flown on February 14, but the photography was unacceptable because of a bad film emulsion.

3. TIDE-COORDINATED PHOTOGRAPHY

Locations of the tide staffs are shown on the chart. The job was completed; photography taken on the 12, 14, 15, 16, and 20, of February. Lines 20-2 and 30-3 were also photographed and portions of the other lines were also partially photographed during August 1971.

Recordings entered in the tide volumes, Form 277, were at 5 minute intervals during photography and at 15 minute intervals near photography. An exception to this is the readings for the MANATEE CREEK and BARNES SOUND staff where the tide varies only a few hundredths of a foot per day. Tolerances of ± 0.30 foot for MHW, ± 0.20 foot for MWL, and ± 0.10 foot for MLW were observed. Wet staff readings - crest, mean, and trough - were recorded while photography was in progress. Eastern Standard Time was used.

Line 20-1. MHW Completed at 1050 on February 14 when the RAGGED KEYS staff read 3.38-3.26. MLW Completed at 1500 on February 14 when the staff read 1.80.

Line 20-2. MHW Flown at 1035-1052 on 16 February when the OCEAN REEF staff read 4.75-4.61. This line was also flown at 1006 on February 15, but the pilot recommended it be rescheduled. MLW Flown at 1338-1350 on February 14 when the staff read 2.31-2.32.

Line 30-1. This line is controlled by three staffs, the MANATEE CREEK staff has a MWL datum and the EAST ARSENICKER and CARD SOUND staffs have mean high and mean low datums. MHW The line was flown at 1120-1142 on 14 February. At this time the EAST ARSENICKER staff read 3.95-3.86 and the MANATEE CREEK staff read 3.54-3.57(MWL). The line was flown again at 1445 on 14 February when the CARD SOUND staff read 3.8 and the MANATEE CREEK staff read 3.60. MLW Was flown at 945-1000 on 20 February when the CARD SOUND staff read 3.2 and the EAST ARSENICKER staff read 2.78-2.81.

Line 30-2. MHW It was completed at 1250 on February 14 when the TAVERNIER, FLA. BAY staff read 3.05 (MWL Range), the BARNES SOUND staff read 3.92, the MANATEE CREEK staff read between 3.6 and 3.5, the CARD SOUND staff read 4.0 and the EAST ARSENICKER staff read 3.65. MLW Completed at 0945 on February 20 when the CARD SOUND staff read 3.20 and the EAST Arsenicker staff read 2.77-2.78.

The BARNES SOUND staff read 0.31 foot higher than its 3.61 Mean Water Level. Since the shoreline in this area is overhung with mangrove this section of the line was not rescheduled.

Line 30-3 (ATLANTIC SIDE). MHW Completed at 1107 on February 16 when the TAVERNIER, HAWK CHANNEL staff read 4.62-4.43. MLW Completed at 1412 on February 14 when the staff read 2.30-2.28.

Line 30-3 (Florida Bay Side). MWL The north side was completed on February 12 at 1150 hrs. when the BARNES SOUND staff read 3.78 and the TAVERNIER, FLA. BAY staff read 2.72. The south end was in range at 1412 on February 14 when 30-3(ATLANTIC SIDE) MLW was flown. The south half was also in range at 1107 on February 16 when 30-3 MHW was flown although the staff was not manned at that time.

4. ADDITIONAL PHOTOGRAPHY

Special photography over Florida's test area was flown between 1005 and 1240 on 20 February with various films. The staff at the EAST ARSENICKER gage was observed and its value recorded at 5 minute intervals during this period. The staff at the

mouth of the northern cut (MANGROVE POINT) was observed and its value recorded at 5 minute intervals from 1135 to 1300 hours. The latter staff values are listed in the EAST ARSENIKER Form 277.

5. FORESHORE PROFILES

Four planetable beach profiles were run within the limits of the job during the photography period of August 1971. The few small beaches found for the profiles were of coral, and since erosion is not considered a problem, these profiles were not rerun.

6. MONITORING OF TEMPORARY TIDE STAFFS IN THE JOB AREA

On February 15 verbal instructions were received from the Chief, Tidal Datum Planes: Temporary staffs were to be put in at 11 selected locations and observed every 12, 15, or 30 minutes through one high and one low water. All 11 need not be observed simultaneously and the actual location could be varied slightly. Four were observed on the 16th., two on the 17th., 1 on the 20th., and four on the 21st. The chart accompanying this report shows the exact location of each staff.

7. FIELD RECORDS

All CSI cards, Form 277's and a copy of the records from the 11 tide staffs were sent to C3413 on 13 March 1972. The original field records for the 11 staffs were forwarded to C3311 on 23 February 1972. Profiles and recovery notes were sent to C3413 on 1 March 1972 with the report for work done on this job in August 1971.

Submitted 14 March 1972

John C. Veselenak

John C. Veselenak
Chief, Photo Party 65

Photogrammetric Plot Report
Hillsboro Inlet to Card Sound, Florida
Job PH-7113
and
Card Sound to Plantation Key, Florida
Job PH-7119

21. Area Covered

This report covers an area on the east coast of Florida immediately south of Hillsboro Inlet to the southwestern end of Plantation Key. Job PH-7113 and Job PH-7119 are combined in this one report because the southern portion of Job PH-7113 is included in the block adjustment of Job PH-7119.

Job PH-7113 consists of twenty (20) 1:10,000 scale sheets: TP-00416 through TP-00420, and TP-00422 through TP-00436.

Job PH-7119 consists of twelve (12) 1:10,000 scale sheets: TP-00444 through TP-00455.

Subsequent to the initial bridging in this area, three small areas were re-bridged using new photography. The reports are attached:

- (1) Port Everglades, Florida
- (2) Miami to Mangrove Point, Florida
- (3) Hollywood to Miami Beach, Florida

22. Method

Eleven (11) strips of photography were bridged using aerotriangulation methods. Tie points were made between strip No. 1 of PH-7113 and strip No. 2 of the Jupiter Inlet to Hillsboro Inlet, Florida report to the north of this area.

Due to the placement of control in relation to flight lines and due to large areas of water coverage, two block adjustments were made. Strip No. 2, No. 3, and No. 4 comprised one block. Strip No. 7, No. 9, No. 10, and No. 11 comprised the other block. Attached is a sketch showing the location of the strips and the blocks.

Image points were located to rectify photographs for orthophoto, nautical, and small craft charts. All points were drilled by the PUG method. Closure to control has been noted on the read-outs. A sketch is attached which shows the control used in the strip and block adjustments. All points were plotted on the Florida East Zone Plane Coordinate System using the Coradomat Plotter or the Calcomp Plotter.

Ratio points were located on twenty-eight (28) strips of infrared contact prints. Additional ratio points were located on contact prints which have a large portion of water coverage so that they could be individually enlarged to scale. A sketch showing the location of the infrared photographs is attached.

23. Adequacy of Control

The control was adequate. Horizontal control was pre-marked on strip No. 1, No. 2, No. 3, No. 4, No. 5, and No. 6. Because of the placement of flight lines in relation to control, it was necessary to extend Strip No. 5 one model past its terminal control station in order to have an area of common coverage with strip No. 6. Tie points were located in this area and tie point 544801 was used as a terminal control point for strip No. 6.

Most of the horizontal control for Strip No. 7, No. 8, No. 9, No. 10, and No. 11 was pre-marked for color photography which was flown on August 4, 1971, and August 11, 1971. This photography was not used for bridging. The positions of the pre-marked control stations were transferred, using PUG methods, to color infrared photography which was flown on March 5, 1973, and March 18, 1973.

The following control station positions were transferred from photographs 71L(C)8370 through 71L(C)8382:

Irving 1971

Mangrove (USE) 1930 Sub Point A

Sands Cut RM2, 1849-1947 Sub station

The following control station positions were transferred from a roll of color photography which was not indexed (Spot No. 100-691A) LC-20:

Rubi, 1930-1948 Reset

Man, 1930

Angelfish Key RM3, 1853

Narrow Point, 1854

Long Sound 1961

Snipe Pt., 1934, substation

Knowlson, 1935, substation

Hull Key, 1852

Rock Harbor 2, 1961

Lower Sound Point, 1853 substation

Sub Station, Key Largo Cable Visions Inc., Taller Mast, 1961

Largo, 1962

Low 2, RM2, 1934

Planter 2, RM4

The following control station positions were transferred from photographs 72L(C)8691R thru 72L(C)8698R:

Tavernier 1935
Snake 1934 Sub. Sta.

Turkey Pt. 2, RM2 was transferred from photograph 71E(C)9595.

Cape Florida Old Tower Finial Sub Station A was transferred from photograph 71E(C)9201.

Lower Sound Point 1853 sbu. station was not used in the adjustment because the field party advised that it was questionable and should be used with caution. Sub. station Key Largo Visions, Inc., Taller Mast, 1961, could not be used because one of its azimuth stations (Key Largo Cable Visions, Inc. Shorter Mast) appears to have a bad published position. To date, this has not been resolved by the Geodesy Division. Turkey Point 2, RM2 was a very poor point to transfer, and, therefore, it was not used as control in the block adjustment in that area.

Part-way through the compilation phase of this project, it was determined that the published control positions in the area of this report were in error approximately - 4 feet in X and -10 ft. in Y. Therefore, Strip No. 1, No. 2, No. 3, No. 4, No. 5, No. 6, and No. 8 are adjusted to the old published control positions. This area includes T-sheets TP-00416 through TP-00420 and TP-00422 through TP-00432.

Strip No. 7, No. 9, No. 10, and No. 11 are adjusted to new preliminary control positions which were furnished by Geodesy on May 29, 1974. Geodesy Division stated this preliminary control will be within one (1) foot of the final adjustment. They also said to base non-main scheme stations on the nearest main scheme stations. This was approved by the Coastal Mapping Division.

Since stations established in 1971 and later have positions which were determined by a different adjustment than stations which were established before 1971, it was necessary that the corrections for non-main scheme stations of 1971 and later be based on the new preliminary control of the nearest main scheme stations of 1971 and later. In like manner, pre-1971 non-main scheme stations are based on the amount of change of the nearest pre-1971 main scheme station.

The compiler was advised to make a graphic adjustment on TP-00430 so it will junction well with TP-00433. Also, TP-00432 should be graphically adjusted so it will junction well with TP-00433, TP-00434, and TP-00435.

A listing of closures to control is included on an attached sheet of control stations. The station with the largest residual is Narrow Point 1854, with 1.808 feet in X and 1.267 feet in Y.

24. Supplemental Data

USGS Topographic Quadrangles and NOS Nautical Charts were used to obtain vertical control for bridging.

25. Photography

The following RC-8 color photography was used for bridging:

1:20,000 scale

Strip No. 4 71E(C)9201-9215
Strip No. 8 73L(C)2871-2884R
Strip No. 9 73L(C)2893-2924R

1:30,000 scale


Strip No. 1 71E(C)9120-9135
Strip No. 2 71E(C)9562-9574
Strip No. 3 71E(C)9576-9586
Strip No. 5 71E(C)9536-9545
Strip No. 6 71E(C)9588-9602

1:40,000 scale

Strip No. 7 73L(C)2935-2945R
Strip No. 10 73L(C)2952-2968R
Strip No. 11 73L(C)2785-2797R


The quality and definition of the photography was adequate.

Respectfully submitted,



Victor McNeel

Approved and forwarded:




John D. Perrow, Jr.
Chief, Aerotriangulation Section

CONTROL STATIONS

			<u>residuals</u>	
1.	(027100)	Turtle 1929	-0.706	-0.115
2.	(023102)	Pompano, 1928, subpoint B	1.488	-0.229
3.	(029100)	South Jetty, 1938	-1.134	0.176
4.	(034101)	Halland, 1928	0.317	-0.007
5.	(567101)	Causeway, 1934	0.027	-0.012
6.	(562101)	Point View, 1934	0.000	-0.181
7.	(207100)	Base, 1934	0.112	0.142
8.	(204100)	Key Biscayne North Base, 1849	-0.158	0.033
9.	(201101)	Cape Florida Old Tower Finial, subpoint A	-0.156	0.002
10.	(538102)	Pan American, 1935, Target 2	0.000	0.000
11.	(534101)	Naco 1934, subpoint A	0.000	0.000
12.	(544801)	Tie point from strip #5 used as control for strip #6	-0.157	0.025
13.	(591100)	Black Point 3	0.351	-0.066
14.	(595101)	Turkey Point No. 2, 1930, RM No. 2	-0.229	0.073
15.	(940100)			
	(602100)	Narrow Point 1854	-1.808	1.267
16.	(944100)	Man 1930.	0.222	-0.009
17.	(960100)	Long Sound, 1961	-0.168	-0.075
18.	(936101)	Snipe Point, 1934, sub- station	-0.215	-0.201
19.	(878101)	Irving, 1971, substation	0.687	-0.080
20.	(875102)	Mangrove (USE), 1930, subpoint B	-0.826	0.125
21.	(872101)	Sands Cut RM 2, 1849-1947 substation	0.296	-0.049
22.	(901100)	Rubi, 1930-1947, reset	-0.192	-0.134
23.	(905101)	Angelfish Key RM 3, 1853	-0.303	-0.242
24.	(914101)	Knowlson, 1935 substation	0.153	-0.155
25.	(919100)	Hull Key, 1852	-0.053	0.103
26.	(922100)	Rock Harbor 2, 1961	0.364	-0.284
27.	(022101)	Lower Sound Point, 1853 substation **		
28.	(923101)	Sub Station Key Largo Cable Visions Inc., Taller Mast, 1961 **		
29.	(924100)	Largo, 1962	-0.210	0.103

30.	(967101)	Low 2, RM 2, 1934	0.042	0.215
31.	(692100)	Tavernier, 1935	0.308	-1.325
32.	(793101)	Planter 2, RM 4	-1.476	1.087
33.	(695101)	Snake, 1934, subpoint	0.128	0.174

** means not used in adjustments

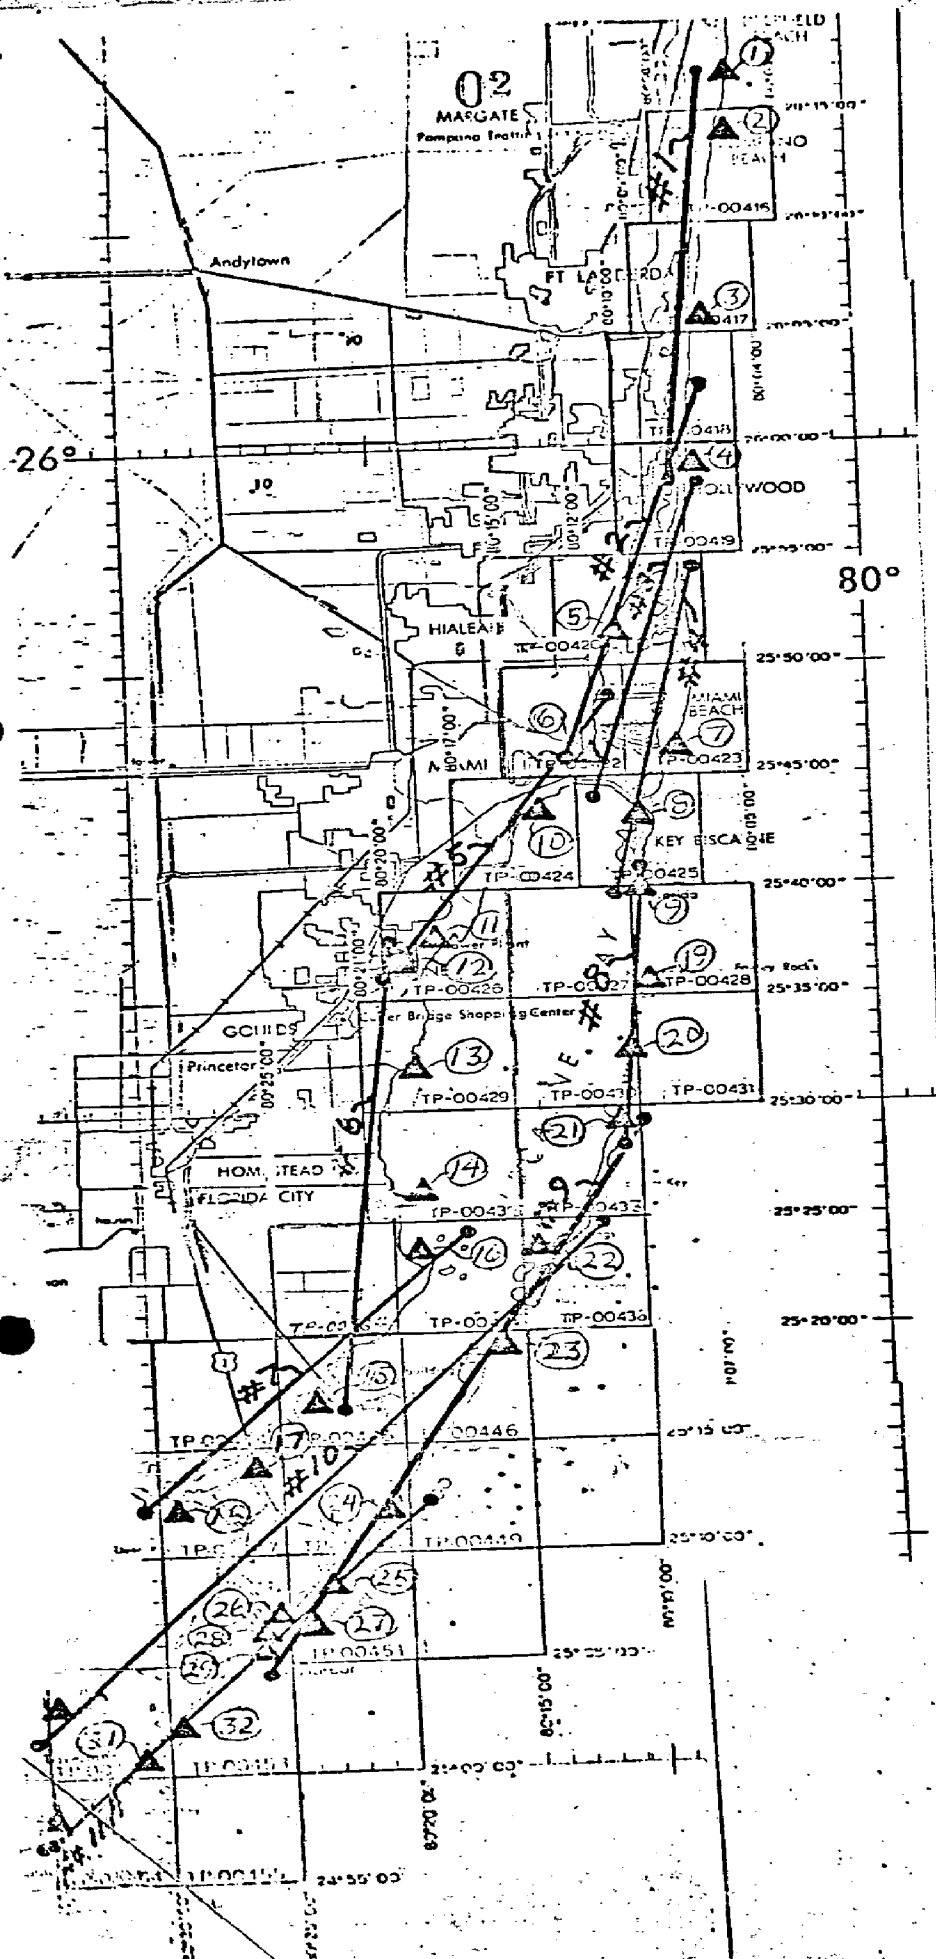


JOB PH-7113
AND
JOB PH-7119

HILLSBORO INLET
TO
PLANTATION KEY,
FLORIDA

CONTROL STATIONS
USED IN THE
ADJUSTMENTS

INFRA-RED CONTACT PRINTS

1. 71K 5632R - 5660R MLW
2. 71K 5662R - 5672R MLW
3. 71K 5750R - 5766R MHW
4. 71K 5795R - 5806R MHW
5. 71K 5815R - 5829R MHW
6. 71L 8501R - 8509R MLW
7. 71L 8512R - 8520R MLW
8. 71L 8571R - 8580R MHW
9. 71L 8523R - 8530R MLW
10. 71L 8783R - 8791R MHW
11. 71L 8584R - 8593R MHW
12. 71L 8532R - 8537R MLW
13. 71L 9067R - 9080R MLW
14. 71L 8337R - 8341R MHW
15. 72K 6287R - 6298R MHW
16. 72K 6572R - 6584R MLW
17. 72K 6546R - 6563R MLW
18. 72K 6311R - 6330R MHW
19. 71L 8544R - 8559R MLW
20. 71L 8648R - 8662R MLW
21. 72K 6480R - 6499R MHW
22. 71L 8697R - 8705R MHW
23. 72K 6344R - 6350R MLW
24. 72K 6253R - 6255R MLW
25. 72K 6420R - 6423R MHW
26. 72K 6501R - 6515R MHW
27. 72K 6368R - 6382R MLW
28. 71K 5847R - 5856R MHW

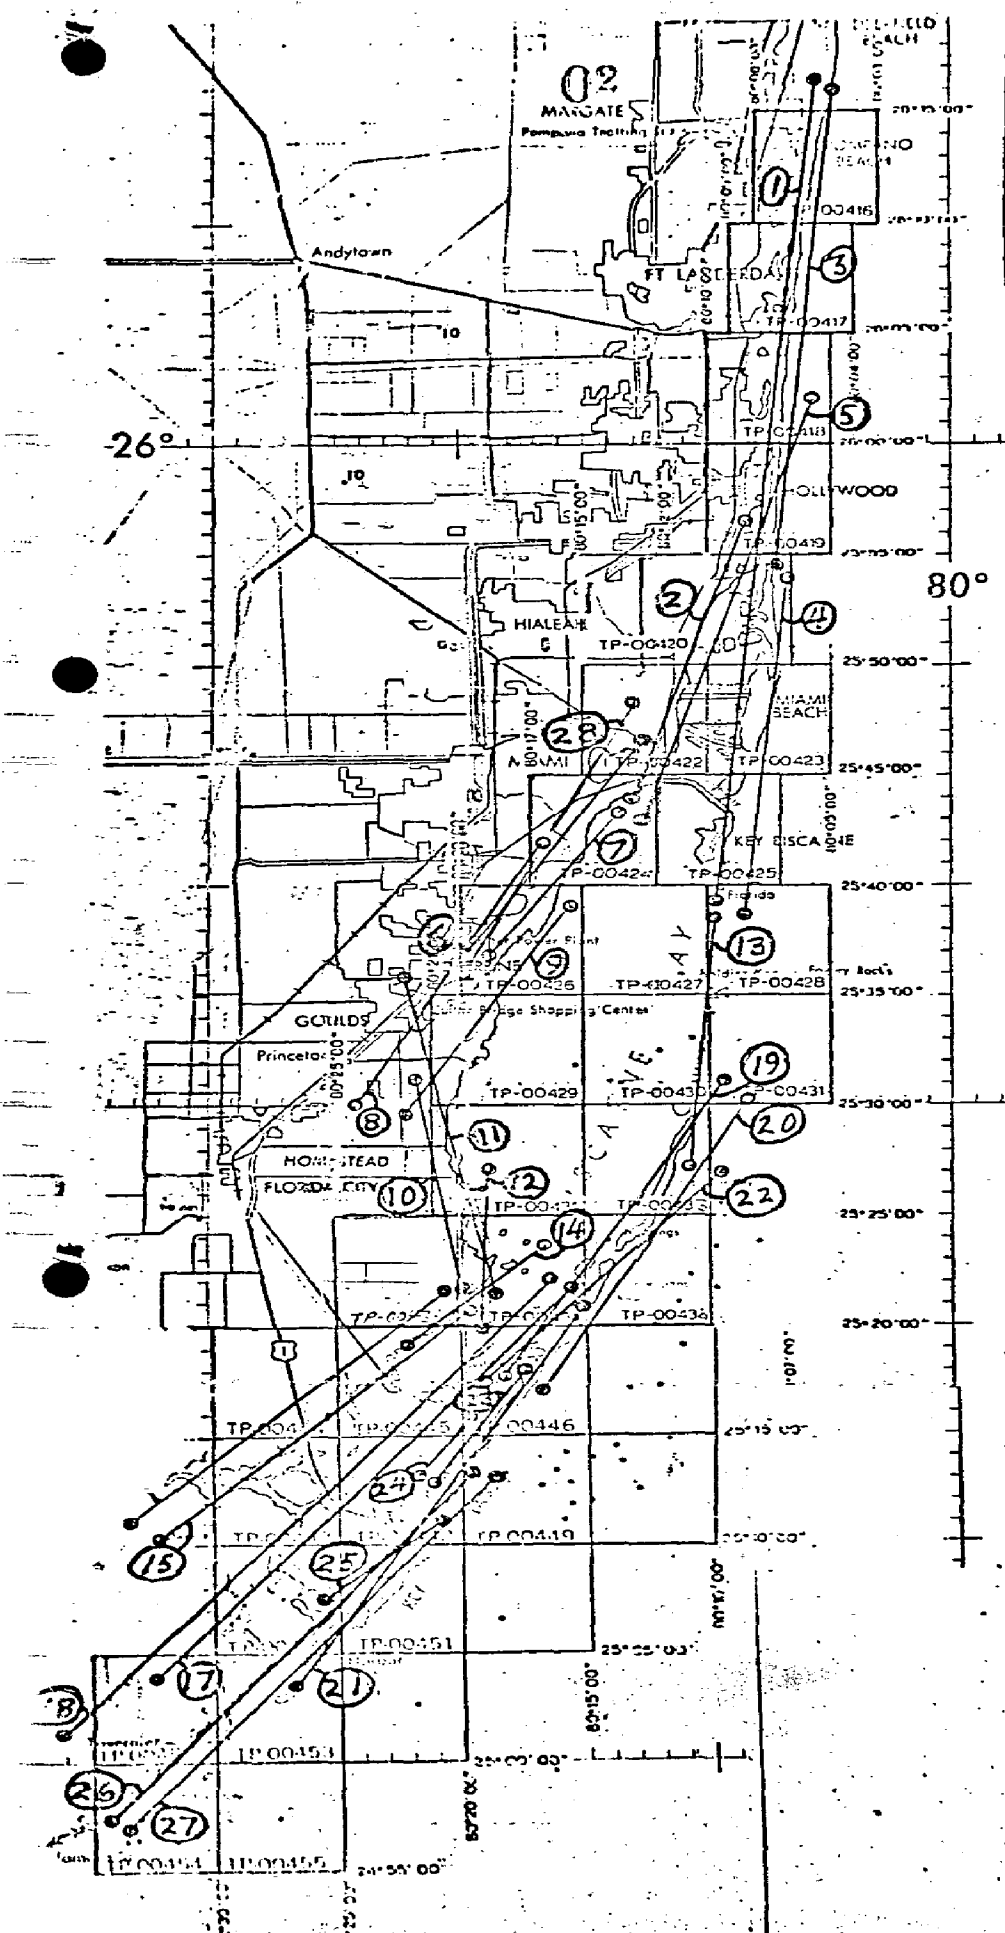

JOB PH-7113
AND
JOB PH-7119

HILLSBORO INLET
TO
PLANTATION KEY,
FLORIDA

INFRA-RED CONTACT
PRINTS RATIOED FOR
COMPILATION

FLORIDA- NOAA Coastal Boundary Mapping Program

Horizontal Control

Map TP- 00452

Station	NOS Geodetic Data Reference for Description, Positions, Coordinates and Azimuths
TAVERNIER U.S. IMMIGRATION, RADIO MAST 1961 LIBRA 2, 1908	D, GP, PC. Fla. Vol. 2, P. 314 GP 368 P.C. 93 Book 425, P. 8, 27, 29, 33, G.P. 368, 425, 8, 27 Fla. Vol. 1, P.C. P. 93, Fla. E. Zone

Compilation Report
TP-00452
June 1975

31. Delineation

The tidal datum lines were delineated from the black-and-white, tide-coordinated infrared photography by graphic methods. This photography was controlled by map points determined by aerotriangulation and planimetric features compiled from the rectified prints of the color infrared photography.

Interior features on TP-00452 are limited to the main roads and to public roads leading to the shoreline. These features were compiled from the rectified prints of the color infrared photography.

32. Horizontal Control

See Photogrammetric Plot Report.

33. Supplemental Data - None

34. Contours and Drainage

Contours are not applicable. Drainage was compiled from the rectified prints of the color infrared photography.

35. Shoreline and Alongshore Detail

The tidal datum lines along the Atlantic Ocean were delineated from office interpretation of the black-and-white, tide-coordinated infrared photography referenced to Tavernier, Hawk Channel Tide Station.

The MWL line was delineated from office interpretation of the black-and-white, tide-coordinated infrared photography referenced to Tavernier, Florida Bay Tide Station.

The shoal and shallow lines were delineated from office interpretation of the rectified black-and-white color photography.

A field edit of these lines is requested for verification of the office interpretation of the photography.

36. Offshore Details

Shoal and shallow lines were compiled from the rectified prints of the color infrared photography.

37. Landmarks and Aids

All landmarks and aids will be located or verified (photographic image) during field edit. Two landmarks and six lights were located by office interpretation by aerotriangulation.

38. Control for Future Surveys - None.39. Junctions

Refer to Form 76-36B (Data Record).

40. Horizontal Accuracy

This map complies with the accuracy requirements for the Florida Coastal Mapping Program as outlined in the project instructions for Job PH-7000.

41. thru 45. Inapplicable.

46. Comparison with Existing Maps

Comparison was made with the following USGS Quad:

Tavernier, Florida, 1971, 1:24,000 scale.

No significant differences were noted.

47. Comparison with Nautical Charts

A comparison was made with the following Nautical Charts:

11451	1:80,000, 12th Edition, Sept. 1974;
1249	1:80,000, 12th Edition, April 1973;
850	1:40,000, 6th Edition, August 1972.

Respectfully submitted,



Peter N. Gibson
Carto (Photo)

Approved and Forwarded:



J. P. Battley, Jr.
Chief, Coastal Mapping Section

FIELD EDIT REPORT MAP TP-00452, JOB PH 7119

51. METHODS

The shoreline was inspected from a small boat while cruising just off shore. Notes regarding apparent and fast shoreline, piers and other along shore details were made on the field edit sheet and the rectified photographs.

Two triangulation station was recovered.

Four vertical control stations were recovered and identified.

Two landmarks are recommended for charting.

All knowm aids were located or verified.

Four tide gages were identified. Tavernier Creek tide gage with bench mark E 276 was identified on photograph 73L2794R. The gage and the bench mark are close together and E 276 was used because it is in the vertical net. Tavermier Hawk Channel tide gage with bench mark V 327 and Tavernier Florida Bay tide gage with bench mark X 327 were identified on photograph 73L2794R. Adoba Cosa tide gage with tidal bench mark No 2 were identified on photograph 73L2793R. Tidal bench mark No 2 falls on TP-00453.

Field edit notes will be found on the rectified photographs, field edit sheet and the discrepancy print.

52. ADEQUACY OF COMPILATION

Adequate after application of field edit.

52. MAP ACCURACY

No test required.

54. RECOMMENDATION

None.

55. EXAMINATION OF PROOF COPY

None required.

Submitted 8/8/75


Robert R. Wagner
Chief, Photo Party 60

Review Report
TP-00452

August 1976

61. General

The map manuscript for Coastal Zone Map TP-00452 was inspected as a Class III map (compilation, discrepancy print, and report) and reviewed as a Class I map by the Quality Control Group. The review consisted of an examination of the map manuscript, the field edit and its application, the reproduction negatives, and the Descriptive Report.

The proof copy of this map was edited by the Quality Control Group before making final copies. This edit comprised a thorough inspection of map details to verify the accuracy of reproduction with reference to the map manuscript and the quality of reproduction. In addition, the proof copy was examined by the following sections:

- Coastal Mapping - map details
- Staff Geographer - geographic names
- Coastal Surveys - horizontal and vertical control

The field reports dated February and March 1972 state that four (4) plane-table beach profiles were run. One (1) of these profiles is within the limits of TP-00452 and was used to verify the tidal datum lines.

62. Cartographic Comparison

Comparison was made with the following USGS quadrangle map:

Tavernier, Florida, 1971, scale 1:24,000.

No significant changes were noted.

Comparison was made with the following nautical chart:

11463 (formerly C&GS 850) 7th Edition, dated August 3, 1974,
1:40,000 scale.


Chart 11463 shows extensive areas of mean low water in the interior waters of Florida Bay. The black-and-white, tide-coordinated infrared photography does not show these areas uncovered and the field edit shows the compilation to be correct.

63 thru 65. Inapplicable.

66. Adequacy of Results and Future Surveys


Coastal Zone Map TP-00452 complies with the Instructions for NOS Cooperative Boundary Mapping, Job PH-7000, and the National Standards of Map Accuracy.

Submitted by:




Donald M. Brant

Approved and Forwarded:

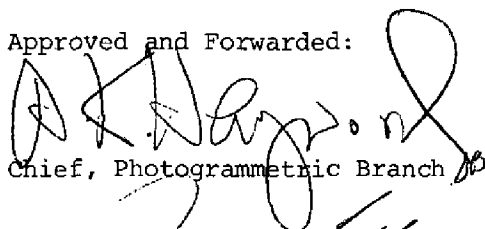

Chief, Photogrammetric Branch

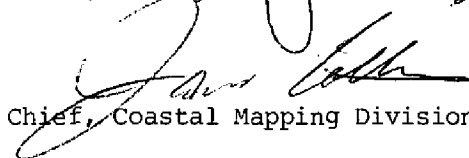

Chief, Coastal Mapping Division

27 Jan. 1975


GEOGRAPHIC NAMES

PH-7119 (Card Sound to Plantation Key, Florida)

TP-00452

Atlantic Ocean	Tavernier
Bottle Key	Tavernier Creek
Butternut Key	Tavernier Harbor
Community Harbor	Upper Cross Bank
Cowpens Cut	
Cross Bank	
Everglades National Park	
Florida Bay	
Hammer Point	
Hawk Channel	
Key Largo	
Low Key	
Pigeon Key	
Plantation Key	
Point Lowe	
Ramshorn Cut	
Ramshorn Shoal	
Stake Key	

Approved by:

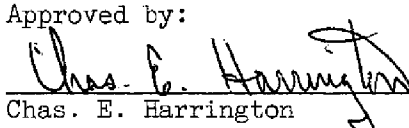
Chas. E. Harrington

Staff Geographer-C51x2

PHOTOGRAMMETRIC BRANCH
COASTAL MAPPING DIVISION

1815

VERSION
18/75

* THE FOLLOWING OBJECTS HAVE NOT BEEN INSPECTED FROM SEAWARD TO DETERMINE THEIR VALUE AS LANDMARKS *

* * *	* DESCRIPTION	* POSITION	* CODES*	* METHOD AND DATE	* * *
* CHARTING*	RECORD REASON FOR DELETION	* LATITUDE	* C-C *	* OF LOCATION	* CHARTS
* NAME	* PUT TRIANGULATION NAMES IN ()	* LONGITUDE	* DP	* OFFICE	* FIELD
					* AFFECTED*

* *	* BISCAYNE BAY -	* *	* *	* *
* *	* LONG KEY	* *	* *	* *

* PYRN *	PIGEON KEY	*	25	3	3.99	122.8	219	*	p-1-3-8	*	11451	*
GAA *		*	26	34	16.00	676.2	1	*	08/05/75	*	11463	*

[illegible]

* LIGHT * HAMMER POINT *	* 25	2 12.30	378.5	200	* 731C2792P *	P-V	*
--------------------------	------	---------	-------	-----	---------------	-----	---

* * *		*	2	1.16	35.7	219	*	p-L-3-8	*
* *	OYBN *	DITTO							*

--	*--*	*--*	*--*	*--*	*--*
--	DYEN *	01110	* 25 1 52.92	1628.3 219 *	* 01110 *

DYBN *	01110	* 25	1 47.41	1458.8	219 *	* 01110	*
--------	-------	------	---------	--------	-------	---------	---

[illegible]

* * *	* COMMUNITY HARBOR	* *	* *	* *	* *	
03	80	ST 44.0	1244.0	19	US 087.0 + US 087.0	UT 10

[illegible]

2	*	*	80	31	29.60	829.9	5	*	08/06/75	*	DI110
---	---	---	----	----	-------	-------	---	---	----------	---	-------

[illegible]

PC	POSITIONS DETERMINED	*	ROBERT R. WAGNER	*	FIELD REPRESENTATIVE	*
AND/OR	AND/OR VERIFIED BY	*	P. DEMPSEY AND VERIFIED BY J. BATTLE	*	OFFICE COMPILER	*
FIELD	FIELD AND OFFICE	*	J. PIPRONE	*	DIGITIZER	*
ACTIVITIES	ACTIVITIES	*	J. TAYLOR	*	DATA PROCESSOR	*

76-40 ●
LISTING
PHOTOGRAMMETRIC BRANCH
COASTAL MAPPING DIVISION

NATIONAL OCEAN SURVEY NOAA
DEPARTMENT OF COMMERCE USA

Tails

* SVY	TP-00452	*	NONFLOATING AIDS FOR CHARIS	* RPT UNIT	CMD ROCKVILLE, MD.	* PAGE	3 OF	4	*
* JOB	PH-7113	*	TO BE CHARGED	* STATE	FLORIDA	*			*
* PRJ	R	*		* LOCALITY	SUIT KEY TO PT.	LOWE*	ORIGINATING	ACTIVITY	*
* DTM	NA 1927	*		* DATE	01/14/76	*	COMPILATION		*

* JOB PH-7113 * NONFLOATING AIDS FOR CHARTS * STATE FLORIDA * *
* PR1 2 * TO BE CHARTED * LOCALITY SUIT KEY TO PT. LOWE*ORIGINATING ACTIVITY* *

* DTM	* NA	* 1927	* DATE	* 01/14/76	* *	* COMPILATION
-------	------	--------	--------	------------	-----	---------------

* THE FOLLOWING OBJECTS HAVE NOT BEEN INSPECTED FROM SEAWARD TO DETERMINE THEIR VALUE AS LANDMARKS *

* *	* DESCRIPTION	* POSITION	* CODES*	* METHOD AND DATE	* *
* CHARTING*	RECORD REASON FOR DELETION	* LATITUDE	C-C *	OF LOCATION	* CHARTS *
* NAME	* PUI TRIANGULATION NAMES IN ()	* LONGITUDE	SEQ *	OFFICE *	FIELD
					* AFFECTED *

	DATE	DESCRIPTION	AMOUNT	CHECK NO.	BANK	MEMO
01/01/2024		PAYROLL	759.7	219	*	* P-L-4-8 *
01/01/2024		COMPENS	25.0	24.69	*	* 11451 *

74	*	80	33	28.20	790.7	13	*	0.8/06/75	*	114.63	*
----	---	----	----	-------	-------	----	---	-----------	---	--------	---

* GIVEN * DITTO *
* 25 0 8.74 26A.9 249 *
* DITTO *

74A * * 80 33 33.33 990.7 14 * * * NITTO *

[illegible][illegible]

★ HAWK CHANNEL ★

.....*

* DYB	*
DYB	I AVERNTER D YRN
DYB	* 25 0 15.34 472.0 219 *
DYB	* DIIO * 11851 *

[illegible]

Year	1990	1991	1992	1993	1994	1995	1996	1997	1998	1999	2000	2001	2002	2003	2004	2005	2006	2007	2008	2009	2010	2011	2012	2013	2014	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	2033	2034	2035	2036	2037	2038	2039	2040	2041	2042	2043	2044	2045	2046	2047	2048	2049	2050	2051	2052	2053	2054	2055	2056	2057	2058	2059	2060	2061	2062	2063	2064	2065	2066	2067	2068	2069	2070	2071	2072	2073	2074	2075	2076	2077	2078	2079	2080	2081	2082	2083	2084	2085	2086	2087	2088	2089	2090	2091	2092	2093	2094	2095	2096	2097	2098	2099	2100																																																																																																																																																																																																
Population (millions)	1.2	1.3	1.4	1.5	1.6	1.7	1.8	1.9	2.0	2.1	2.2	2.3	2.4	2.5	2.6	2.7	2.8	2.9	3.0	3.1	3.2	3.3	3.4	3.5	3.6	3.7	3.8	3.9	4.0	4.1	4.2	4.3	4.4	4.5	4.6	4.7	4.8	4.9	5.0	5.1	5.2	5.3	5.4	5.5	5.6	5.7	5.8	5.9	6.0	6.1	6.2	6.3	6.4	6.5	6.6	6.7	6.8	6.9	7.0	7.1	7.2	7.3	7.4	7.5	7.6	7.7	7.8	7.9	8.0	8.1	8.2	8.3	8.4	8.5	8.6	8.7	8.8	8.9	9.0	9.1	9.2	9.3	9.4	9.5	9.6	9.7	9.8	9.9	10.0	10.1	10.2	10.3	10.4	10.5	10.6	10.7	10.8	10.9	11.0	11.1	11.2	11.3	11.4	11.5	11.6	11.7	11.8	11.9	12.0	12.1	12.2	12.3	12.4	12.5	12.6	12.7	12.8	12.9	13.0	13.1	13.2	13.3	13.4	13.5	13.6	13.7	13.8	13.9	14.0	14.1	14.2	14.3	14.4	14.5	14.6	14.7	14.8	14.9	15.0	15.1	15.2	15.3	15.4	15.5	15.6	15.7	15.8	15.9	16.0	16.1	16.2	16.3	16.4	16.5	16.6	16.7	16.8	16.9	17.0	17.1	17.2	17.3	17.4	17.5	17.6	17.7	17.8	17.9	18.0	18.1	18.2	18.3	18.4	18.5	18.6	18.7	18.8	18.9	19.0	19.1	19.2	19.3	19.4	19.5	19.6	19.7	19.8	19.9	20.0	20.1	20.2	20.3	20.4	20.5	20.6	20.7	20.8	20.9	21.0	21.1	21.2	21.3	21.4	21.5	21.6	21.7	21.8	21.9	22.0	22.1	22.2	22.3	22.4	22.5	22.6	22.7	22.8	22.9	23.0	23.1	23.2	23.3	23.4	23.5	23.6	23.7	23.8	23.9	24.0	24.1	24.2	24.3	24.4	24.5	24.6	24.7	24.8	24.9	25.0	25.1	25.2	25.3	25.4	25.5	25.6	25.7	25.8	25.9	26.0	26.1	26.2	26.3	26.4	26.5	26.6	26.7	26.8	26.9	27.0	27.1	27.2	27.3	27.4	27.5	27.6	27.7	27.8	27.9	28.0	28.1	28.2	28.3	28.4	28.5	28.6	28.7	28.8	28.9	29.0	29.1	29.2	29.3	29.4	29.5	29.6	29.7	29.8	29.9	30.0	30.1	30.2	30.3	30.4	30.5	30.6	30.7	30.8	30.9	31.0	31.1	31.2	31.3	31.4

1

0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99

[illegible]

1. The first step in the process is to identify the problem or issue that needs to be addressed. This involves gathering information and understanding the context of the problem.

[illegible][illegible][illegible]

.....

1
 2
 3
 4
 5
 6
 7
 8
 9
 10
 11
 12
 13
 14
 15
 16
 17
 18
 19
 20
 21
 22
 23
 24
 25
 26
 27
 28
 29
 30
 31
 32
 33
 34
 35
 36
 37
 38
 39
 40
 41
 42
 43
 44
 45
 46
 47
 48
 49
 50
 51
 52
 53
 54
 55
 56
 57
 58
 59
 60
 61
 62
 63
 64
 65
 66
 67
 68
 69
 70
 71
 72
 73
 74
 75
 76
 77
 78
 79
 80
 81
 82
 83
 84
 85
 86
 87
 88
 89
 90
 91
 92
 93
 94
 95
 96
 97
 98
 99
 100
 101
 102
 103
 104
 105
 106
 107
 108
 109
 110
 111
 112
 113
 114
 115
 116
 117
 118
 119
 120
 121
 122
 123
 124
 125
 126
 127
 128
 129
 130
 131
 132
 133
 134
 135
 136
 137
 138
 139
 140
 141
 142
 143
 144
 145
 146
 147
 148
 149
 150
 151
 152
 153
 154
 155
 156
 157
 158
 159
 160
 161
 162
 163
 164
 165
 166
 167
 168
 169
 170
 171
 172
 173
 174
 175
 176
 177
 178
 179
 180
 181
 182
 183
 184
 185
 186
 187
 188
 189
 190
 191
 192
 193
 194
 195
 196
 197
 198
 199
 200
 201
 202
 203
 204
 205
 206
 207
 208
 209
 210
 211
 212
 213
 214
 215
 216
 217
 218
 219
 220
 221
 222
 223
 224
 225
 226
 227
 228
 229
 230
 231
 232
 233
 234
 235
 236
 237
 238
 239
 240
 241
 242
 243
 244
 245
 246
 247
 248
 249
 250
 251
 252
 253
 254
 255
 256
 257
 258
 259
 260
 261
 262
 263
 264
 265
 266
 267
 268
 269
 270
 271
 272
 273
 274
 275
 276
 277
 278
 279
 280
 281
 282
 283
 284
 285
 286
 287
 288
 289
 290
 291
 292
 293
 294
 295
 296
 297
 298
 299
 300
 301
 302
 303
 304
 305
 306
 307
 308
 309
 310
 311
 312
 313
 314
 315
 316
 317
 318
 319
 320
 321
 322
 323
 324
 325
 326
 327
 328
 329
 330
 331
 332
 333
 334
 335
 336
 337
 338
 339
 340
 341
 342
 343
 344
 345
 346
 347
 348
 349
 350
 351
 352
 353
 354
 355
 356
 357
 358
 359
 360
 361
 362
 363
 364
 365
 366
 367
 368
 369
 370
 371
 372
 373
 374
 375
 376
 377
 378
 379
 380
 381
 382
 383
 384
 385
 386
 387
 388
 389
 390
 391
 392
 393
 394
 395
 396
 397
 398
 399
 400
 401
 402
 403
 404
 405
 406
 407
 408
 409
 410
 411
 412
 413
 414
 415
 416
 417
 418
 419
 420
 421
 422
 423
 424
 425
 426
 427
 428
 429
 430
 431
 432
 433
 434
 435
 436
 437
 438
 439
 440
 441
 442
 443
 444
 445
 446
 447
 448
 449
 450
 451
 452
 453
 454
 455
 456
 457
 458
 459
 460
 461
 462
 463
 464
 465
 466
 467
 468
 469
 470
 471
 472
 473
 474
 475
 476
 477
 478
 479
 480
 481
 482
 483
 484
 485
 486
 487
 488
 489
 490
 491
 492
 493
 494
 495
 496
 497
 498
 499
 500
 501
 502
 503
 504
 505
 506
 507
 508
 509
 510
 511
 512
 513
 514
 515
 516
 517
 518
 519
 520
 521
 522
 523
 524
 525

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55
56
57
58
59
60
61
62
63
64
65
66
67
68
69
70
71
72
73
74
75
76
77
78
79
80
81
82
83
84
85
86
87
88
89
90
91
92
93
94
95
96
97
98
99
100
101
102
103
104
105
106
107
108
109
110
111
112
113
114
115
116
117
118
119
120
121
122
123
124
125
126
127
128
129
130
131
132
133
134
135
136
137
138
139
140
141
142
143
144
145
146
147
148
149
150
151
152
153
154
155
156
157
158
159
160
161
162
163
164
165
166
167
168
169
170
171
172
173
174
175
176
177
178
179
180
181
182
183
184
185
186
187
188
189
190
191
192
193
194
195
196
197
198
199
200
201
202
203
204
205
206
207
208
209
210
211
212
213
214
215
216
217
218
219
220
221
222
223
224
225
226
227
228
229
230
231
232
233
234
235
236
237
238
239
240
241
242
243
244
245
246
247
248
249
250
251
252
253
254
255
256
257
258
259
260
261
262
263
264
265
266
267
268
269
270
271
272
273
274
275
276
277
278
279
280
281
282
283
284
285
286
287
288
289
290
291
292
293
294
295
296
297
298
299
300
301
302
303
304
305
306
307
308
309
310
311
312
313
314
315
316
317
318
319
320
321
322
323
324
325
326
327
328
329
330
331
332
333
334
335
336
337
338
339
340
341
342
343
344
345
346
347
348
349
350
351
352
353
354
355
356
357
358
359
360
361
362
363
364
365
366
367
368
369
370
371
372
373
374
375
376
377
378
379
380
381
382
383
384
385
386
387
388
389
390
391
392
393
394
395
396
397
398
399
400
401
402
403
404
405
406
407
408
409
410
411
412
413
414
415
416
417
418
419
420
421
422
423
424
425
426
427
428
429
430
431
432
433
434
435
436
437
438
439
440
441
442
443
444
445
446
447
448
449
450
451
452
453
454
455
456
457
458
459
460
461
462
463
464
465
466
467
468
469
470
471
472
473
474
475
476
477
478
479
480
481
482
483
484
485
486
487
488
489
490
491
492
493
494
495
496
497
498
499
500
501
502
503
504
505
506
507
508
509
510
511
512
513
514
515
516
517
518
519
520
521
522
523
524
525
526
527
528
529
530
531
532
533
534
535
536
537
538
539
540
541
542
543
544
545
546
547
548
549
550
551
552
553
554
555
556
557
558
559
560
561
562
563
564
565
566
567
568
569
570
571
572
573
574
575
576
577
578
579
580
581
582
583
584
585
586
587
588
589
590
591
592
593
594
595
596
597
598
599
600
601
602
603
604
605
606
607
608
609
610
611
612
613
614
615
616
617
618
619
620
621
622
623
624
625
626
627
628
629
630
631
632
633
634
635
636
637
638
639
640
641
642
643
644
645
646
647
648
649
650
651
652
653
654
655
656
657
658
659
660
661
662
663
664
665
666
667
668
669
670
671
672
673
674
675
676
677
678
679
680
681
682
683
684
685
686
687
688
689
690
691
692
693
694
695
696
697
698
699
700
701
702
703
704
705
706
707
708
709
710
711
712
713
714
715
716
717
718
719
720
721
722
723
724
725
726
727
728
729
730
731
732
733
734
735
736
737
738
739
740
741
742
743
744
745
746
747
748
749
750
751
752
753
754
755
756
757
758
759
760
761
762
763
764
765
766
767
768
769
770
771
772
773
774
775
776
777
778
779
780
781
782
783
784
785
786
787
788
789
790
791
792
793
794
795
796
797
798
799
800
801
802
803
804
805
806
807
808
809
810
811
812
813
814
815
816
817
818
819
820
821
822
823
824
825
826
827
828
829
830
831
832
833
834
835
836
837
838
839
840
84

1. $\frac{1}{2}$

* POSITIONS DETERMINED * ROBERT R. WAGNER * FIELD REPRESENTATIVE *

AND/OR VERIFIED BY	* P. DEMPSEY AND VERIFIED BY J. RATTLE	* OFFICE COMPILER	*
FIELD AND OFFICE	* J. PIRRONE	* DIGITIZER	*
ACTIVITIES	* J. TAYLOR	* DATA PROCESSOR	*

76-43

PHOTOGRAMMETRIC BRANCH
COASTAL MAPPING DIVISIONNATIONAL OCEAN SURVEY NOAA
DEPARTMENT OF COMMERCE USA

DIPL

VERSION
09/18/75

LISTING

SVY	IP	PH	PRJ	DTM	NA	DATE	UNIT	STATE	LOCALITY	DATE	ORIGINATING ACTIVITY	PAGE	OF	4
IP-00432							CMD	FLORIDA	PI. LOWE	01/14/76	COMPILATION			
PH-7113							FLORIDA							
PRJ R														
DTM NA	1927													

THE FOLLOWING OBJECTS HAVE BEEN INSPECTED FROM SEAWARD TO DETERMINE THEIR VALUE AS LANDMARKS

NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
MAST	TAVERNIER U.S. IMMIGRATION	HI=195(260)	25 0 31.92	982.1	NOT	TRIG. REC.	11451
MAST	RADIO MAST	HI=195(260)	80 31 10.53	295.3	DGIZD	08/06/75	11463
MAST	US NAVY	HI=229(235)	25 0 24.41	751.1	86	P-V	1249
MAST			30 31 12.70	356.1	23	08/06/75	DITTO

THE FOLLOWING OBJECTS HAVE BEEN INSPECTED FROM SEAWARD TO DETERMINE THEIR VALUE AS LANDMARKS

NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
MAST	TAVERNIER U.S. IMMIGRATION	HI=195(260)	25 0 31.92	982.1	NOT	TRIG. REC.	11451
MAST	RADIO MAST	HI=195(260)	80 31 10.53	295.3	DGIZD	08/06/75	11463
MAST	US NAVY	HI=229(235)	25 0 24.41	751.1	86	P-V	1249
MAST			30 31 12.70	356.1	23	08/06/75	DITTO

THE FOLLOWING OBJECTS HAVE BEEN INSPECTED FROM SEAWARD TO DETERMINE THEIR VALUE AS LANDMARKS

NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
MAST	TAVERNIER U.S. IMMIGRATION	HI=195(260)	25 0 31.92	982.1	NOT	TRIG. REC.	11451
MAST	RADIO MAST	HI=195(260)	80 31 10.53	295.3	DGIZD	08/06/75	11463
MAST	US NAVY	HI=229(235)	25 0 24.41	751.1	86	P-V	1249
MAST			30 31 12.70	356.1	23	08/06/75	DITTO

THE FOLLOWING OBJECTS HAVE BEEN INSPECTED FROM SEAWARD TO DETERMINE THEIR VALUE AS LANDMARKS

NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
MAST	TAVERNIER U.S. IMMIGRATION	HI=195(260)	25 0 31.92	982.1	NOT	TRIG. REC.	11451
MAST	RADIO MAST	HI=195(260)	80 31 10.53	295.3	DGIZD	08/06/75	11463
MAST	US NAVY	HI=229(235)	25 0 24.41	751.1	86	P-V	1249
MAST			30 31 12.70	356.1	23	08/06/75	DITTO

THE FOLLOWING OBJECTS HAVE BEEN INSPECTED FROM SEAWARD TO DETERMINE THEIR VALUE AS LANDMARKS

NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
MAST	TAVERNIER U.S. IMMIGRATION	HI=195(260)	25 0 31.92	982.1	NOT	TRIG. REC.	11451
MAST	RADIO MAST	HI=195(260)	80 31 10.53	295.3	DGIZD	08/06/75	11463
MAST	US NAVY	HI=229(235)	25 0 24.41	751.1	86	P-V	1249
MAST			30 31 12.70	356.1	23	08/06/75	DITTO

THE FOLLOWING OBJECTS HAVE BEEN INSPECTED FROM SEAWARD TO DETERMINE THEIR VALUE AS LANDMARKS

NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
MAST	TAVERNIER U.S. IMMIGRATION	HI=195(260)	25 0 31.92	982.1	NOT	TRIG. REC.	11451
MAST	RADIO MAST	HI=195(260)	80 31 10.53	295.3	DGIZD	08/06/75	11463
MAST	US NAVY	HI=229(235)	25 0 24.41	751.1	86	P-V	1249
MAST			30 31 12.70	356.1	23	08/06/75	DITTO

THE FOLLOWING OBJECTS HAVE BEEN INSPECTED FROM SEAWARD TO DETERMINE THEIR VALUE AS LANDMARKS

NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
MAST	TAVERNIER U.S. IMMIGRATION	HI=195(260)	25 0 31.92	982.1	NOT	TRIG. REC.	11451
MAST	RADIO MAST	HI=195(260)	80 31 10.53	295.3	DGIZD	08/06/75	11463
MAST	US NAVY	HI=229(235)	25 0 24.41	751.1	86	P-V	1249
MAST			30 31 12.70	356.1	23	08/06/75	DITTO

THE FOLLOWING OBJECTS HAVE BEEN INSPECTED FROM SEAWARD TO DETERMINE THEIR VALUE AS LANDMARKS

NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
NAME	DESCRIPTION	REASON FOR DELETION	POSITION	CODES	METHOD AND DATE	LOCATION	CHARTS
MAST	TAVERNIER U.S. IMMIGRATION	HI=195(260)	25 0 31.92	982.1	NOT	TRIG. REC.	11451
MAST	RADIO MAST	HI=195(260)	80 31 10.53	295.3	DGIZD	08/06/75	11463
MAST	US NAVY	HI=229(235)	25 0 24.41	751.1	86	P-V	1249
MAST			30 31 12.70	356.1	23	08/06/75	DITTO

TYPE OF ACTION

NAMES OF RESPONSIBLE PERSONNEL

ORIGINATOR

OBJECTS INSPECTED FROM SEAWARD

ROBERT R. WAGNER

PHOTO FIELD PARTY

POSITIONS DETERMINED

ROBERT R. WAGNER

FIELD REPRESENTATIVE

AND/OR VERIFIED BY

P. DEMOSSEY AND VERIFIED BY J. BATTLE

OFFICE COMPILER

FIELD AND OFFICE

J. PIRRONE

DIGITIZER

ACTIVITIES

J. TAYLOR

DATA PROCESSOR

Federal Record Center Data

TP-00452

- 1 Discrepancy print (paper copy)
- 1 Field edit sheet (stable base)
- 1 NOAA Form 76-36 C (History of Field Operations)
- 3 NOAA Forms 76-40 (Working Copies Landmark and Nonfloating Aids)

PhotographG:

72K6378

73L(C) 2793R, 2794R, 2966R, 2967R