NOAA FORM 76-35

U.S. DEPARTMENT OF COMMERCE NATIONAL OCEANIC AND ATMOSPHERIC ADMINISTRATION NATIONAL OCEAN SURVEY

DESCRIPTIVE REPORT

Type of Survey Shoreline
Job No
Classification No. Final Edition No1
Field Edited Map
LOCALITY
State California
Locality . Point Mugu
19 74 TO 19 76
REGISTRY IN ARCHIVES
DATE

☆ U.S. GOVERNMENT PRINTING OFFICE: 1974-762-901

18740

NOAA FORM 76-36A U. S. DEPARTMENT OF COMMERC	E TYPE OF SURVEY SURVEY	TP-00780
(3-72) NATIONAL OCEANIC AND ATMOSPHERIC ADM		TION NO. (1)
DECCRIPTIVE REPORT DATA RECORD		ASS Final
DESCRIPTIVE REPORT - DATA RECORD	1	XMCM_7404
PHOTOGRAMMETRIC OFFICE	REVISED JOB	
Coastal: Mapping Division	LAST PRECEEDING MAP E	DITION
Norfolk, Va.	TYPE OF SURVEY JOB	PH
OFFICER-IN-CHARGE		ASS ————
	1 = 1	DATES:
Jeffrey G. Carlen, Cdr.) 19
1. INSTRUCTIONS DATED		
1, OFFICE	2, FIELD	· · · · · · · · · · · · · · · · · · ·
Aerotriangulation 11/4/74	į	
Compilation 1/8/75	Premarking	1/30/74
•	Premarking	3/14/74
	Amendment I	
	· ·	
II. DATUMS		
1. HORIZONTAL: X 1927 NORTH AMERICAN	OTHER (Specify)	
TIONIZON AZI	OTHER (C/(n)	
■ MEAN HIGH-WATER	OTHER (Specify)	
2. VERTICAL:		
MEAN SEA LEVEL		
3. MAP PROJECTION	4. GRID(S)	
Polyconic	STATE ZONE	
Folyconic	California 5	and 7
5. SCALE 1:10,000	STATE ZONE	
III. HISTORY OF OFFICE OPERATIONS		
OPERATIONS	NAME	DATE
	B. Thornton	Jan 1975
METHOD: Analytic LANDMARKS AND AIDS E		
2. CONTROL AND BRIDGE POINTS PLOTTED E	R. Robertson	Feb 1975
METHOD: Coradomat CHECKED E	R. Robertson	Feb 1975
3. STEREOSCOPIC INSTRUMENT PLANIMETRY E	J. Byrd	Nov 1975
COMPILATION CHECKED E	B. H. Barnes	Nov 1975
INSTRUMENT:Wild B-8 CONTOURS		
SCALE: 1:15,000 CHECKED E		D- 1075
4. MANUSCRIPT DELINEATION PLANIMETRY 6		Dec 1975 Dec 1975
CHECKED E		Dec 1975
METHOD: Smooth drafted contours a		
HYDRO SUPPORT DATA F		Dec 1975
scale: 1:10,000 CHECKED E		Dec 1975
	A. L. Shands	Dec 1975
	L. O. Neterer Jr.	Jun 1977
6. APPLICATION OF FIELD EDIT DATA CHECKED B	1	Oct 1977
7. COMPILATION SECTION REVIEW	y J. Byrd	Oct 1977
	A. L. Shands	Mar 1979
	A. L. Shands	Apr 1979
10. DATA EXAMINED IN PHOTOGRAMMETRIC BRANCH B	Y F. R. WATTS	JUN 1979

NOAA FORM 76- (3-72)	-36B			NATIONAL O		ATMOSPHERI	ENT OF COMMERCE C ADMINISTRATION
		C	TP-00'	780 DN SOURCES		NATION	AL OCEAN SURVEY
1. COMPILATIO	N PHOTOGRAPI		<u> </u>				
CAMERA(S)			ТҮР	S OF PHOTOGRAPH	Y T		
	C-8 "L"			LEGEND		TIME REF	FERENCE
TIDE STAGE RE			(0) 00	LOR	ZONE		
REFERENCE	TIDES E STATION RECO	DROS	(P) P#	NCHROMATIC	Pac	ific NAN	X STANDARD
- T.	ROLLED PHOTO		(l) IN	FRARED	120		DAYLIGHT
NUMBE	R AND TYPE	DATE	ТІМ	E SCALE		STAGE	OF TIDE
1-(-(0)	1000 1006				+ .		
*74L(C)	1023-1026	03/04/74	11:03			2 ft. of	
**74L(I) **74L(I)	2231 - 2235 1596 - 1599	04/05/74	l l	,	700	2 ft. of	MHW
^^/4L(I)	1390-1399	03/21/74	14:58	1:30,0	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	2 ft. of	MLTM
REMARKS			 '-				
		d compilation					
3	**Tide coor	dinated photog	graphy at	: MHW and MLLW	T		
2. SOURCE OF	MEAN HIGH-WA	TER LINE:					
r	The mean hi	gh water line	was comp	iled graphica	11y from	the abov	ve listed
, t	ide coordi	nated photogra	phy.		-		
3. SOURCE OF	MEAN LOW-WAT	ER OR MEAN LOWER	LOW-WATER	LINE:			
J. 500		CH ON MEAN CONER					
							. ,
т	he mean lo	wer low water	line was	compiled are	nhically	fwom the	
		d tide coordir			phically	110m CHe	;
-		a crac oborari	acco piic	cography.			
							•
4. CONTEMPO	RARY HYDROGR	APHIC SURVEYS (Lis	t only those s	urveys that are source	s for photogra	mmetric surve	y information.)
SURVEY NUMB		· · · · · · · · · · · · · · · · · · ·	OPY USED	SURVEY NUMBER	DATE(S)		VEY COPY USED
0011461 11011151	DA / 2(3)	JOHVE	OF 1 03ED	SORVET NOMBER	JA . E(3)	301	VET COPT 0320
					İ		
5. FINAL JUNG	TIONS					L:	
NORTH		EAST		SOUTH		WEST	
No surv	ey	TP-00781		No survey		TP-007	79
REMARKS							

NOAA FORM 76-36C 3-72	TP-00780 History of Field	NATIONAL OCEANIC A		
I. T FIELD INSPECTION OF		D EDIT OPERATION		
	DPERATION	NAME		DATE
1. CHIEF OF FIELD PARTY				- 1 107/
1. CHELOT TIELD PARTY		R. Melby		Feb 1974 Feb 1974
1 HODITONTAL CONTROL	RECOVERED BY	L. Riggers		reb 1974
2. HORIZONTAL CONTROL	ESTABLISHED BY PRE-MARKED OR IDENTIFIED BY	None L. Riggers		Feb 1974
	RECOVERED BY	NA NA		160 1774
. VERTICAL CONTROL	ESTABLISHED BY	NA NA		
, VERNIONE CONTINUE	PRE-MARKED OR IDENTIFIED BY	NA NA		
		None		-
4. LANDMARKS AND	RECOVERED (Triangulation Stations) BY	None		
AIDS TO NAVIGATION	LOCATED (Field Methods) BY	None		
	TYPE OF INVESTIGATION	Hone	_	
5. GEOGRAPHIC NAMES	COMPLETE		1	
INVESTIGATION	SPECIFIC NAMES ONLY			
	V NO INVESTIGATION			
6. PHOTO INSPECTION	CLARIFICATION OF DETAILS BY	None		
7. BOUNDARIES AND LIMITS		None		-
II. SOURCE DATA			•	
HORIZONTAL CONTROL H	DENTIFIED	2. VERTICAL CONTROL NA	DENTIFIED	
PHOTO NUMBER	STATION NAME	PHOTO NUMBER	STATION DESIGN	TION
74L(C) 1024 LAGUN	A 2, 1951			
3. PHOTO NUMBERS (Clarific	ation of details)	<u> </u>		· <u></u>
NOne				
4. LANDMARKS AND AIDS TO	NAVIGATION IDENTIFIED	***************************************		
None		_	·	
PHOTO NUMBER	OBJECT NAME	PHOTO NUMBER	OBJECT NAM	E
5. GEOGRAPHIC NAMES:	REPORT XX NONE	6. BOUNDARY AND LIM	ITS: REPORT	XX NONE
7. SUPPLEMENTAL MAPS AN			Name of the second	
None				
8. OTHER FIELD RECORDS ($1-{ m form} \ 15$	Sketch books, etc. DO NOT list data submit	ted to the Geodesy Division)	
1 101111 13	-			


NOAA FORM 76-36C (3-72)		TP- HISTORY OF	-00780 FIELD (NATIONAL OCEA	U.S. NIC AND AT	DEPARTMENT MOSPHERIC A NATIONAL	DMINI	STRATION
I. FIELD INSPE	ECTION OPERATION	ON [X FIELD	EDIT OPERATION				
	OPERAT	ION			NAME		D	ATE
1. CHIEF OF FIEL	D PARTY			J. P. Randa	.11		Dec	1976
		RECOVER	REDBY	None	• • •	+	Dec	1770
2. HORIZONTAL C	ONTROL	ESTABLISH		None				
	P	RE-MARKED OR IDENTIF	TEDBY	None				
		RECOVE	RED BY	None				
3. VERTICAL CON	TROL	ESTABLISH	HED BY	None				
	P	RE-MARKED OR IDENTIF	IED BY	None				· · · · · · · · · · · · · · · · · · ·
	RECOV	ERED (Triangulation Statis	ons) BY	None				
4. LANDMARKS AN	lD.	LOCATED (Field Metho	-	J. C. Osbor	n Jr.		Dec	1976
AIDS TO NAVIGA	ATION	IDENT1F	-	J. C. Osbor	n Jr.		Dec	1976
		TYPE OF INVESTIGATION						
5. GEOGRAPHIC N		COMPLETE	BY					
INVESTIGATION	l	SPECIFIC NAMES OF	NLY			1		
		XX NO INVESTIGATION						
6. PHOTO INSPECT	TION C	LARIFICATION OF DETA	IL\$ BY	J. C. Osbor	n Jr.		Dec	1976
7. BOUNDARIES AL	NO LIMITS	SURVEYED OR IDENTIF	TED BY	NA				
II. SOURCE DATA								
1. HORIZONTAL C	ONTROL IDENTIF	IED		2. VERTICAL CO	NTROL IDEN	TIFIED		
None				None_				
PHOTO NUMBER		STATION NAME		PHOTO NUMBER	ST	ATION DESIG	N A TIO	٧
3. PHOTO NUMBER	RS (Clarification of	details)			1			
74L(I) 1597 thr	u 74L(I) 1600						
4. LANDMARKS AN	ID AIDS TO NAVIO	ATION IDENTIFIED						
PHOTO NUMBER		OBJECT NAME		PHOTO NUMBER	. ===	OBJECT NA	ME	
74L(I) 1597	SLIDE							
74L(I) 1600	TOWER	_						
74L(I) 2235	TWIN TANK	S						
F GEOGRAPHIC "	AMES. T-	V		4 DOWNER 151	D 1 100 T =	F*7 == × ·		
 GEOGRAPHIC N SUPPLEMENTAL 		REPORT XX NONE		6. BOUNDARY AN	D LIMITS:	REPORT	(X)	NONE
	ne	13						
8. OTHER FIELD F	RECORDS (Sketch I	ooks, etc. DO NOT list de	ta submitt	ed to the Geodesv D	ivision)			
		eld Edit Ozalid						
76-40 Form a	ınd approved	tide readings P	t. Mug	u				

U. S. DEPARTMENT OF COMMERCE NATIONAL OCEANIC AND ATMOSPHERIC ADMINISTRATION

TP-00780

RECORD OF SURVEY USE

		RECUI	KD OF SURVE	1 035	-			
I. MANUSC	RIPT COPIES			,				
	CO	MPILATION STAGE	S			DATE	MANUSCRI	PT FORWARDED
<u> </u>	DATA COMPILED	DATE	RE	MARKS		MARINE	CHARTS	HYDRO SUPPORT
Compile	tion complete		Class III	manuscr	int			
	field edit	Dec 1975	supercede		-50	9/29	/76	3/17/76
}	. +		,		\neg		<i>.</i>	- , - , , · ,
	dit applied					•		
compila	tion complete	Jun 1977	Class I m	anuscrip	t	Jul	1978	None
Final R	eview	Mar 1979	Final			Apr	1979	
			111111			- debr	.,,,,	
	ARKS AND AIDS TO NAVIGA			· · · · · ·				
1. REP	ORTS TO MARINE CHART DI	VISION, NAUTICAL I	DATA BRANCH					
NUMBER	CHART LETTER Number Assigned	DATE, FORWARDED			REMA	RKS		
	1	-						
1		Oct.17,1977	7 landmar	ks for cl	harts			
		1						
		!						
								
								_
					-			•
			<u> </u>					
2.	REPORT TO MARINE CHART	DIVISION, COAST	PILOT BRANCH.	DATE FORW	VARDED:	Oct.	17,19	77
3.	REPORT TO AERONAUTICA	L CHART DIVISION	, AERONAUTICAL	DATA SECT	ION. DA	TE FOR	WARDED:	
III. FEDER	RAL RECORDS CENTER DAT	'A						
				🗀			=-	
1· 🗓 2. 🗀	BRIDGING PHOTOGRAPHS; CONTROL STATION IDENTI	LXI DUPLICATE	TORM NO	16-40 8 887 SHEMIT)MPUTEF TED =>	FIFL D.4	UIS. Partife	
	SOURCE DATA (except for G							'
ت	ACCOUNT FOR EXCEPTION		, = = = = = ·				-	
: -								
	DATA TO FEDERAL RECOF							
IV. SURVE	Y EDITIONS (This section s	JOB NUMBER		pedition is re			SURVEY	
SECOND	TP.	(2) PH			REV			URVEY
EDITION	DATE OF PHOTOGRAPH		ELD EDIT	1		MAPC		
				։ □л.	<u> </u>		□ v.	FINAL
	SURVEY NUMBER	JOB NUMBEI	R				SURVEY	
THIRD	TP.	(3) PH		ļ [.]	∐ REV			ÜRVEY
EDITION	DATE OF PHOTOGRAPH	DATE OF FI	ELD EDIT	<u>□</u> 11.	□ու	MAP C	LASS	FINAL
	SURVEY NUMBER	JOB NUMBER					SURVEY	LIFINAL
FOURTH	TP	. (4) PH			REV		RES	DRVÉY
EDITION	DATE OF PHOTOGRAPH		ELD EDIT			MAP		i
LUITION			•	□n.	□ III.	□iv.	□v. ;	DFINAL

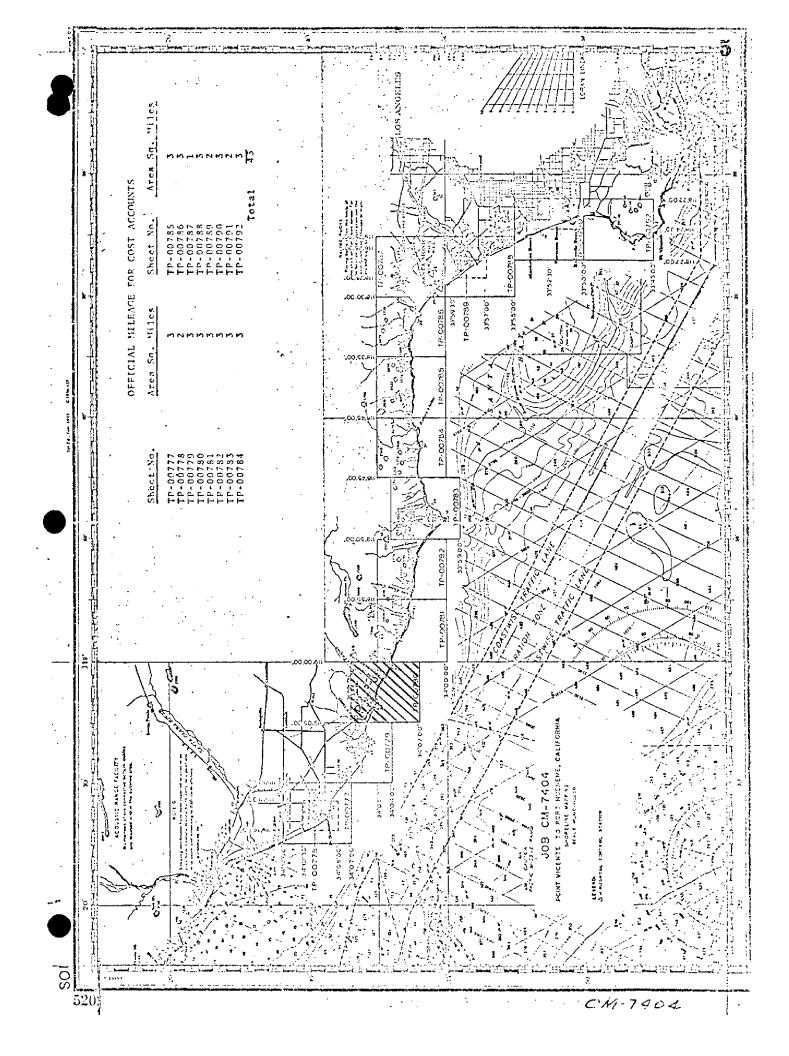

SUMMARY TO ACCOMPANY

TP-00777 through TP-00792

Maps included in this summary comprise all of project CM-7404, Point Vicente to Port Hueneme, California. All but three of the sixteen maps in this project are 1:10,000 scale. The others, TP-00778, TP-00789 and TP-00791 are each 1:5,000 scale. All are standard shoreline maps, the purpose of which is to provide up-to-date shoreline and alongshore delineation for contemporary hydrographic surveys and for nautical chart construction.

The project area is immediately northwest of the city of Los Angeles. The shoreline is a mixture of wide, smooth, sandy beach and rough, rocky cliff areas.

Field operations prior to delineation did not include clearification of photographic details. They were limited to the recovery and identification of horizontal control and providing ground support needed to obtain tide coordinated photography.

Three sets of photographs were supplied and used for the delineation of each map. Natural color photographs were used for bridging and instrument compilation. Tide coordinated, black and white infrared photographs were used to graphically compile the mean high water line and mean lower low water line. The 1:5,000 scale maps were compiled with 1:15,000 scale photographs. The 1:10,000 scale maps were compiled with 1:30,000 scale photographs.

Bridging was done at the Washington Science Center in January 1975. Ratios were determined and ordered at that time. All maps were compiled at the Atlantic Marine Center in the Spring of 1975.

Field edit was performed in three parts. Maps TP-00785 through TP-00792 were edited in the fall of 1975. The location of some offshore features was not completed until the spring of 1976. At that time Maps TP-00781 through TP-00784 were edited. Maps TP-00777 through TP00780 were edited in the fall of 1976. All edit was applied at the AMC.

Final Review was performed at the Atlantic Marine Center in the Winter of 1979. The original base maps and all pertinent data was forwarded to the Washington Science Center for reproduction and final registration.

FIELD INSPECTION

TP-00780

Field inspection was limited to the recovery and identification of horizontal control for aerotriangulation, and ground support for the tide coordinated infrared photography.

Photogrammetric Plot Report Point Vicente to Port Hueneme Job CM-7404

JAHUARY 1973

21. Area Covered

The area covered by this report is the southwest coast of California from Point Vicente to Port Hueneme. This area is covered by thirteen 1:10,000-scale sheets, TP-00777 thru TP-00792, with the exception of sheets TP-00778, 789, and 791, which are at a scale of 1:5,000.

22. Method

Five strips of 1:30,000-scale color photography were bridged by analytic aerotriangulation methods. The five strips of bridging photography were controlled by field-identified control including some control from previous airport surveys which were used as checks.

Common points were located on the bridging photography and the tide-controlled IR for ratio purposes. In addition, common points were located on the bridging and compilation photography. The points read on the bridging strips are more than adequate for compilation purposes. The points were used in all five strips to insure an adequate junction of all strips during the strip adjustments.

23. Adequacy of Control

Control checked well within map accuracy standards and is more than sufficient for intended use. The results from the 1:30,000 bridging photography were adequate enough so as to not make it necessary to bridge the 1:15,000 compilation photography. See attached sheet for accuracy of control in strip adjustment.

24. Supplemental Data

USGS quadrangles were used to provide vertical control for the adjustment.

25. Photography

The coverage, overlap, and quality of the photography was adequate for the job.

. Submitted by, .

Approved and forwarded:

Brian F. Thornton

John D. Perrow, Jr. Chief, Aerotriangulation Section

Attachment


	· - · · · ·	•	•	ment
				OR Y-ERROR
	Strip#1	9/01		
	i produce de la companie de la comp			
	i pominina de la companio della comp	/3/0/		
المستعاضية وسا			a in the management of the box	
	Strip#2:	13101		.253
				58/
		28100	1,455_	.573
				246
* 14. _ ** 14.				
	STrip #3.	28/00	.626	1.068
				1.023
				204
		and the second second second second	engel for the second sector for the second sector of the sector o	
	STrip #4:	108101	-1.954	873
	#	/////	2.7/8	3.046
e nome sou par a source determine of the second	Market and the second of the second	113101	/23	-2.005
	· · · · · · · · · · · · · · · · · · ·	17100	-1.029	525
	. <u></u>	8101	.382	-363
				·
	Strip#5	99100	.00/	.001
	_			00/
				.0/7

.

POINT VICENTE TO PORT HUENEME, CALIFORNIA JOB CM-7404 1:15,000 COMPILATION PHOTOS 1:30,000 BRIDGING PHOTOS ,0E,01h:

1:30,000 & COCCING CAPTIOS 741-1009-1015 1018-1035 1040-1058 1107-1123 1099-1104 1:15,000 CONFILMINA 74-1-1163-1191

\$ 744-1035

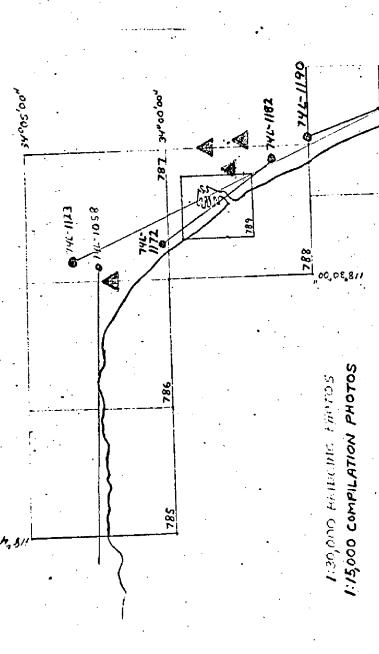

JOB CM-7404

Point vicente to


PORT HUENEME, CALIFORNIA

200 - 1117 - 1107 - 200Z

JOB CM-7404


(

POINT VICENTE TO PORT HUENEME, CALIFORNIA

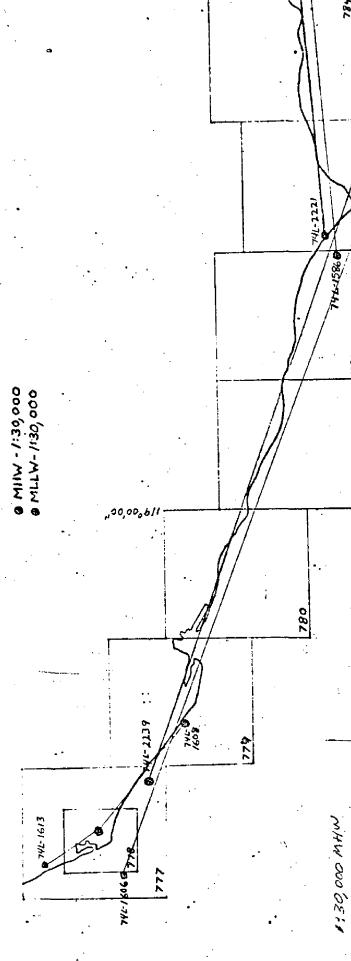

1:30,000 MHW 74-6-2223-2239 2209-2221 2194-2207

133,000 74-4-1608-163 1589-1584 1587-1584

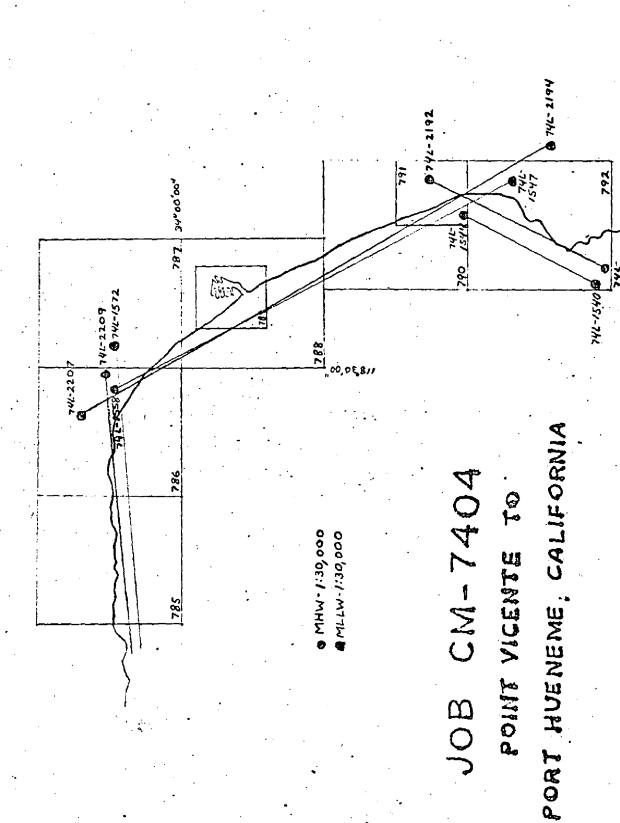

1.11

CALLEST BENNESS

C

€


C


8ģ

JOB CM-7404

(

POINT VICENTE TO PORT HUENEME, CALIFORNIA

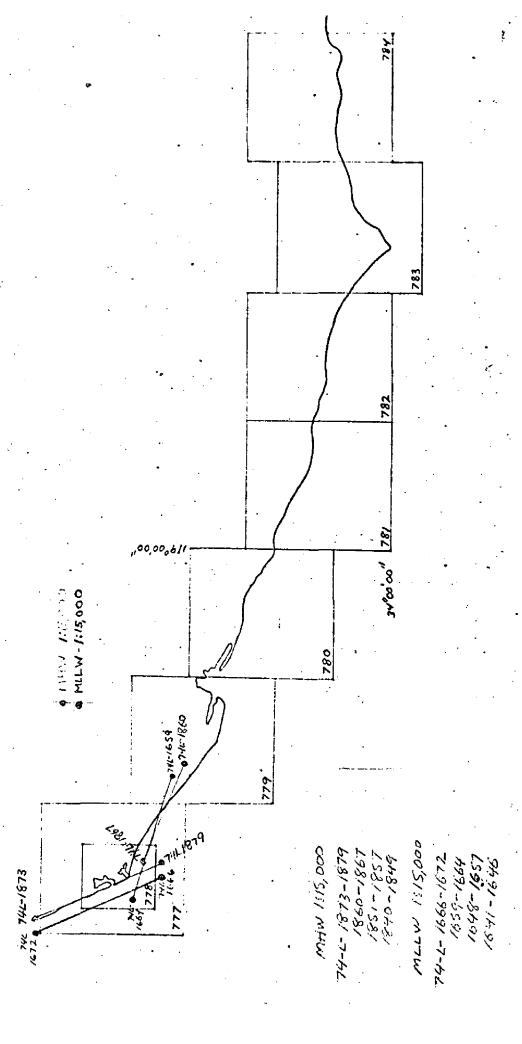

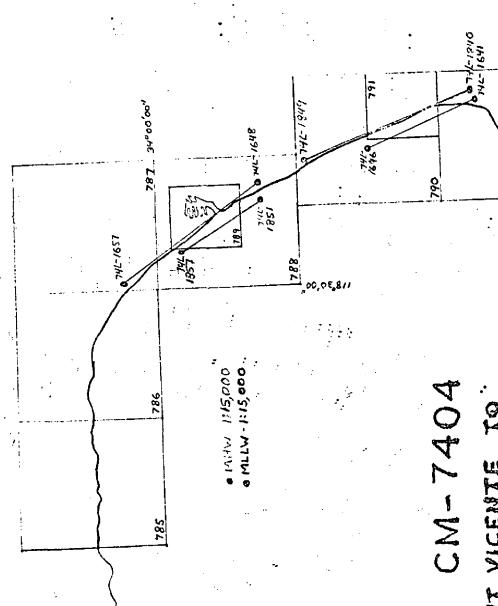

€:

C

O

C

JOB CM-7404
point vicente to:
port hueneme, california

(6-75)		DESCRIPTIVE	E REPORT CONTROL RECORD		U.S. DETAKIMENI OF COMMEKCE NATIONAL OCEANIC AND ATMOSPHERIC ADMINISTRATIÓN	ICSPHERIC ADS	T COMMERCE IINISTRATION
MAP NO.	JOB NO.				ORIGINATING ACTIVITY	,	
TP-00780	CM-7404	7	ΝĀ	1927 Div		Coastal Norfolk, Va.	Mapping
	SOURCE OF	AEROTRI-	COORDINATES IN FEET		1		
STATION NAME	INFORMATION (Index)	POINT	STATE	φ LATITUDE λ LONGITUDE	DE JDE	REMARKS FORWARD	BACK
	Quad 341192		=%	ф 34 04 13	.528	416.8	(1431.9)
PACIFIC, 1927	1081		<i>η</i> =	λ 119 00 16	16.120	413.3	(1125.2)
	Quad 341192		<i>χ</i> =	φ 34 05 07	.590	233.9	(1614.8)
MUGU POINT, 1932	1078		ή=	λ 119 03 34	34.710	889.9	(648.4)
_	Quad 341192		χ=	ф 34 06 27	27.463	849.2	(5.666)
BUILDING, (NE CORNER) 1951	1008		ij=	λ 119 03 51	51.428	1318.2	(219.7)
LAGUNA PARK TRANSMITTER	Quad 341192		χ#.	φ 34 06 32	32.010	986.3	(862.4)
	1008		<i>ψ</i> =	λ 119 03 53	53.585	1373.4	(164.4)
	Quad 341192		=χ	φ 34 06 30	30,7604	8.746	(6.006)
LAGUNA 2, 1951	1008		β±	λ 119 03 51	.1382	1310.7	(227.1)
			<i>-</i> χ	φ			
			នក៍	γ			•
			=χ	ф			
			=ĥ	γ			
			±X	φ		i	
			y=	γ			
			-χ	4			
			<i>ή</i> =	γ			
			χ=	Ф			
			y.	۲			
COMPUTED BY A. C. Rauck, Jr.		27/25/75	COMPUTATION CHECKED BY J.	Byrd		DATE2/25/7	/75
LISTED BY		DATE	LISTING CHECKED BY			DATE	
HAND PLOTTING BY		DATE	HAND PLOTTING CHECKED BY			DATE	
		SUPERSEDES NO	ERSEDES NOAA FORM 76-41, 2-71 EDITION WHICH IS OBSOLETE	CH IS OBSOLETE.			9

COMPILATION REPORT

TP-00780

31. DELINEATION:

Delineation was by the Wild B-8 stereoplotter. Delineation of the mean high and mean lower low water lines was accomplished by graphic methods, using MHW and MLLW tide coordinated infrared ratios, controlled with common pass points selected during the instrument compilation of interior details. The tonal quality of the MHW ratios was not good.

32. CONTROL:

See Photogrammetric Plot Report, dated January 1975.

33. SUPPLEMENTAL DATA:

None.

34. CONTOURS AND DRAINAGE:

Contours are not applicable to the project. Drainage was delineated by office interpretation of the photographs.

35. SHORELINE AND ALONGSHORE DETAILS:

Alongshore details were delineated by office interpretation of the photographs.

The mean high water line and mean lower low water line were compiled from the tide coordinated infrared ratioed photographs.

36. OFFSHORE DETAILS:

None.

37. LANDMARKS AND AIDS:

Work copies of Forms 76-40 were forwarded to the field editor for verification, location and/or deletion of landmarks and aids in the area.

38. CONTROL FOR FUTURE SURVEYS:

None.

39. JUNCTIONS:

See Form 76-36b, item #5 concerning junctions.

40. HORIZONTAL AND VERTICAL ACCURACY:

No statement.

46. COMPARISON WITH EXISTING MAPS:

A comparison has been made with USGS quadrangle Point Mugu, California (1:24,000 scale), dated 1949, Photo Revision 1967.

47. COMPARISON WITH NAUTICAL CHARTS:

A comparison has been made with National Ocean Survey Chart 18720 (1:232,188 scale), 17th edition, dated September 14, 1974.

ITEMS TO BE APPLIED TO NAUTICAL CHARTS IMMEDIATELY:

None.

ITEMS TO BE CARRIED FORWARD:

None.

Submitted by:

J. R. Minton

Cartographic Technician Dec. 9, 1975

Approved:

Albert C. Rauck, Jr.

Chief, Coastal Mapping Section, AMC

GEOGRAPHIC NAMES

FINAL NAME SHEET

CM-7404 (Point Vicente to Port Hueneme, California)

TP-00780

Big Sycamore Canyon '

Mugu Lagoon

Calleguas Creek &

'Pacific Ocean

La Jolla Canyon

Point Mugu

Approved by:

Charles E. Harrington Chief Geographer

NOAA FORM 75-74				U.S. DEPARTMENT OF COMMERCE
(7-75)	PHO	TOGRAMMET	RIC OFFICE REVIEW	NATIONAL OCEAN SURVE
			- 00780	
1. PROJECTION AND GRIDS	T2. TITLE		3. MANUSCRIPT NUMBERS	4. MANUSCRIPT SIZE
			, , , , , , , , , , , , , , , , , , , ,	
ALS	ALS	•	ALS	ALS
CONTROL STATIONS	· _			·····
5. HORIZONTAL CONTROL ST. THIRD-ORDER OR HIGHER A	ATIONS OF	6. RECOVERAS	BLE HORIZONTAL STATIONS AN THIRD-ORDER ACCURACY	7. PHOTO HYDRO STATIONS
	·	(Topographic	stations)	
ALS 8. BENCH MARKS	7. PLOTTING	OF SEVEANT	NA	NA
a DENGTI MATTI	FIXES	or pearanty	10. PHOTOGRAMMETRIC PLOT REPORT	THE DETAIL POINTS
NA	N	A	ALS	ALS
ALONGSHORE AREAS (Neutical	! Chart Data)			
12. SHORELINE	13. LOW-WATE	RLINE	14. ROCKS, SHOALS, ETC.	15. BRIDGES
			1	
ALS 16. AIDS TO NAVIGATION	ALS	/c	ALS 18. OTHER ALONGSHORE	ALS 19. OTHER ALONGSHORE
TO ALDO TO HATTON TON			PHYSICAL FEATURES	CULTURAL FEATURES
ALS	ALS		ALS	a ALS
PHYSICAL FEATURES	<u> </u>		<u> </u>	
20. WATER FEATURES		21. NATURAL	GROUND COVER	22. PLANETABLE CONTOUR
•				
ALS	T-21.	<u> </u>	A '-	NA
23. STEREOSCOPIC INSTRUMENT CONTOURS	24. CONTOURS	IN GENERAL	25. SPOT ELEVATIONS	26. OTHER PHYSICAL FEATURES
NA	NA		NA	ALS
CULTURAL FEATURES	<u> </u>		<u> </u>	<u>- </u>
27. ROADS	28. BUILDINGS	3	29. RAILROADS	-30. OTHER CULTURAL FEATURES
			1	į
ALS	ALS		ALS	ALS
BOUNDARIES 31, BOUNDARY LINES			32. PUBLIC LAND LINES	
NA		•	l .	NA
MISCELLANEOUS			<u>. , , , , , , , , , , , , , , , , , , ,</u>	<u> </u>
33. GEOGRAPHIC NAMES		34. JUNCTIONS		35. LEGIBILITY OF THE
			*** 0	·
ALS 36. DISCREPANCY OVERLAY	37. DESCRIPTI	VE BEDORY	ALS	ALS
OU DISCREPANCE OVERERS	DESCRIPTI	VE REPORT	PHOTOGRAPHS	39. FORMS
ALS	ALS		NA.	ALS
40. REVIEWER	L		SUPERVISOR, REVIEW SECT	ON OR UNIT
Q.L. Shand			albert C. Ko	auch. Jr.
A. L. Shands	12/	16/75	Albert C. Rauck,	Jr.
11. REMARKS (See attached shee			- 	
FIELD COMPLETION ADDITION				
script is now complete exc	furnished by the ept as noted und	e field completi ler item 43.		to the manuscript. The manu-
COMPILER Jowell () h. 1 L. O.Neterei	en fr.	6/77	SUPERVISOR /	Danie de 1
J. ByAd	_	0/// 0/2/77	I Albert C. Rauck	7 carcos. y.
Him	Dyref 1		Albert C. Rauck,	/ 4- =
43. REMARKS				
See 76-360 Sec	tion 8	•		
		•		

NOAA FORM 76-35

U.S. DEPARTMENT OF COMMERCE
NATIONAL OCEANIC AND ATMOSPHERIC ADMINISTRATION
NATIONAL OCEAN SURVEY

DESCRIPTIVE REPORT

Type of Survey FIELD ED	ĮŢ,
Job No CM-7494	Map No
Classification No.	Edition No
LOCAL	_ITY
State CALIFORNIA	
General LocalitySOUTH	ERN CALIFORNIA
ė.	
Locality PT. MUGU, PO	
CHANNEL ISLA	NDS HARBOR
1976 TO	19 76
game volgerena en anna anna penjar pro-	
REGISTRY IN	ARCHIVES
DATE	

FIELD EDIT

PT. MUGU, PORT HUENEME, AND CHANNEL ISLANDS HARBOR

JOB CM-7404

OPR-411-RA-76

MANUSCRIPT NO. TP-00777, 00780; 1:10,000

TP-00778; 1:5000

J.P. RANDALL, CAPT., NOAA COMMANDING OFFICER

Introduction and Methods

Field Edit for Port Hueneme, Channel Islands Harbor, and Pt. Mugu, JOB CM-7404, OPR-411-RA-76, commenced on November 1, 1976, and was completed on December 2, 1976. Two field units performed the majority of all work. The largest portion of shoreline verification, location of dangers to navigation, and photo signal location work was accomplished by walking the shoreline. The remainder was performed from small boats paralleling the beach. Field edit is complete and thorough for three 1:10,000 scale manuscripts and one 1:5,000 scale manuscript that comprise JOB CM-7404.

Field edit operations began inside Port Hueneme on 1:5000 scale manuscript TP-00778 in order to facilitate commencement of hydrographic survey operations on H-9666. Work on this manuscript then progressed northwest to encompass Channel Islands Harbor and the shoreline between. In addition to shoreline verification and location of dangers to navigation for TP-00778, photo signal location was accomplished to provide position control for the 1:5000 scale visual hydrographic survey of Port Hueneme and Channel Islands Harbor. More discussion on this can be found later in the text.

Concurrent with field edit operations on TP-00778, work was begun at southeastern JOB limits of the 1:10,000 scale manuscript TP-00780. Work progressed northwest to the completion of TP-00780, TP-00779, and TP-00777 to the general area junction with 1:5000 manuscript TP-00778. Finally work shifted to the northwestern JOB limits on TP-00777 and moved southeast to the junction with TP-00778.

In conjunction with shoreline verification, location of dangers to navigation, and photo signal identification, questions from the Master Field Edit Sheets relating to the locations of fixed aids to navigation and landmarks for charts were thoroughly investigated and answered, and are noted on the Masters with cross-referencing.

All deletions, additions, and corrections to the final shoreline appear on the Master Field Edit Sheets and on the processed cronopaque photographs. With the exception of the photo signal location work, the Master Field Edit Sheets are indices of all field edit work carried out. All discrepancies and questions listed on the Master Field Edit Sheets are completely answered on the Master. Proper references are included for each question answered. SPECIAL VIOLET ink field notes on the Master Field Edit Sheets are items that have been verified by field edit. The photograph number for each item is given as a reference. SPECIAL RED ink was used on the Masters to indicate changes or additions found during field edit. Position or location references are included. Finally, those field notes inked in green are deletions from the manuscripts. References are included. All notes on the Master Field Edit Sheets which are verified on the cronopaque photographs include the

description or an explanation of the feature verified and the photo number on which the item was located. All shoreline information on the smooth boatsheets for H-9666 and H-9667 which was verified by field edit was inked in black. Changes, which include deletions, and/or additions were inked on the smooth boatsheets in SPECIAL RED. Blue, the smooth boatsheet color for unverified items, was not used due to the completeness of verification on all manuscripts.

For a reference of photograph number - T-Sheet Manuscripts, refer to "Separates Following the Text." Height data on rocks was estimated to plus or minus 1 foot, and the bluffs on the manuscripts to plus or minus 10 feet for those judged less than 200 feet, and plus or minus 50 feet for those judged greater than 200 feet. All items are referenced to Greenwich Mean Time.

Adequacy of Compilation

The compilation of the manuscripts for JOB CM-7404 were complete and adequate. Compilation of the MHWL was generally good, although there is a general shift seaward of the MHWL as compared to the office compiled MHWL. Reference the Masters and manuscript sections of the text for more complete information and recommendations. The MLLWL was compiled where possible by hydrographic survey operations and is not discussed in this report. For further information on survey operations, DESCRIPTIVE REPORTS, H-9666 and H-9667 should be consulted.

TP-00777; 1:10,000

Field edit for this manuscript was begun and completed on December 2, 1976. The central region of this manuscript, bounded by the following: North, Lat. 34 10' 30" N, South, Lat. 34 08' 00" N, East, Lon. 119 11' 30" W, and West, Lon. 119 14' 00" W is the area covered by manuscript TP-00778, scale 1:5000. Field edit is complete and thorough for TP-00777.

All investigations for non-floating aids to navigation and landmarks for charts have been completed for this manuscript. One landmark is being submitted for charting purposes. Refer to the Master Field Edit Sheet, "Separates Following the Text," Form 76-40, and Horizontal Control Report OPR-411-RA-76 for further information. Questions, discrepancies, and notes to the field editor have been completely answered with proper cross-referencing.

Along the entire shoreline of this manuscript, the MHWL shows a general shift seaward of from 10 to 40 feet over the previously compiled MHWL. Several measurements were made from photogrammetrically recoverable points to the field compiled MHWL. In all other cases the MHWL is believed by the field editor to be the interface between the light and dark sand along the shore. This interface is photogrammetrically identifiable. It is recommended that the field compiled MHWL be acpted for charting purposes.

The seaward extending arms of two canals are located at the following positions:

Their seaward extension is less than that compiled due to drying or flow decrease in the canals. The revised delineation is noted on the Master and is recommended for charting.

The investigations of the charted sewer line and pipe lines at the following positions: 34° 08' 06" N x 119° 10' 55" W and 34° 07' 45" N x 119° 10' 25" W is complete. Nothing was discovered after inspection from both land and sea. The recommendation is that they be deleted.

Marshlands cover the area landward of the sand and gravel shoreline between the easternmost north-south canal and the complex containing the Ormond Beach Stacks which are being submitted as landmarks. The marshes appear to be drying or to be in the process of being drained. Onshore from the marshlands are irrigated fields that are being farmed.

The well compiled just southwest of the Ormond Beach Stacks is in actuality a holding pond with earthen banks forming a levee-like structure around the perimeter. There is a second pond with similar levee-like earthen buildup due west of the filled one. It is recommended that they both be compiled for charting purposes as noted on the Master Field Edit Sheet.

TP-00778

Shoreline verification for this manuscript began at the NW entrance to Port Hueneme Harbor, Lat. 34° 08′ 45″ N, Lon. 119° 12′ 40″ W, and progressed clockwise around Port Hueneme Harbor. This was followed by an investigation of Channel Islands Harbor, commencing at Channel Islands Harbor South Jetty Light and continuing counterclockwise to Channel Islands Harbor North Jetty Light. Field work then continued on the beach south of Port Hueneme Harbor. Upon completion of this portion, the investigation then moved north to the north end of Oxnard Beach, at Lat. 34° 10′ 15″ N, Lon. 119° 14′ 00″ W and work progressed southeastward to the jetty. The offshore breakwater was examined. Field edit is complete and thorough for TP-00778.

All non-floating aids to navigation and landmarks for charts have been thoroughly researched and discussed. Questions, discrepancies, and notes to the field editor have been completely answered. Refer to Master Field Edit Sheet, Form 76-40, and Horizontal Control Report; OPR-411-RA-76 for further information.

In the west fork of Channel Islands Harbor, Lat. 34° 10' 25" N, Lon. 119° 13' 35" W, eight piers, forming four groups of two's have been

constructed. These piers are similar to piers already shown to be in existence, Lat. 34° 10′ 15″ N, Lon. 119° 13′ 35″ W. These piers were located by visually comparing photographs with structures present in the field.

Dredging has taken place in the east fork of Channel Islands Harbor, at Lat. 34° 10′ 20″ N, Lon. 119° 13′ 20″ W. The shoreline was delineated by taking three-point sextant fixes (positions 16-21 in Field Edit Sounding Volume) using geodetic, photogrammetric, and hydrographic signals for control. Geographic positions were computed by using RK-300, UTILITY COMPUTATION PACKAGE, refer to "Separates Following the Text" for further information. A small cement boat ramp has been constructed in this newly dredged area.

Additional piers have been constructed on the east side of Channel Islands Harbor, Lat. 34° 10′ 05″ N, Lon. 119° 13′ 20″ W. Three mobile boat cranes (cranes having four wheels that enable them to ride along the top of specially constructed piers and pick up small boats using a sling) exist in this area. Reference the Master for further information. It is recommended that they be charted.

Two sandy shoal areas exist along the north jetty of Channel Islands Harbor. The northeast shoal has a white spar buoy with "shoal" in orange printed on it. For further information see <u>DESCRIPTIVE REPORT</u>, H-9666, OPR-411-76.

The surf zone along the beaches in the Port Hueneme and Channel Islands Harbor area has been affected by dredging in the area. This zone has moved inshore along all these beaches.

The width and length of the breakwater offshore of Channel Islands Harbor was determined with respect to the aids to navigation present. One end of a steel tape was attached to the aid to navigation and measurements were made to the tip of the breakwater from a Boston Whaler that moved along the water's edge. See page thirteen of Field Edit Sounding Volume for these actual measurements.

The wreck charted between Channel Islands Harbor and the breakwater was, according to the Channel Islands Harbor Patrol, removed four years ago. RAINIER recommends removal of the wreck from chart. Refer to the Master Field Edit Sheet for further information.

A wreck at Port Hueneme West Jetty Light 3 has been covered with sand and riprap placed around the sand. Thus the wreck now forms a beach area. There is no visible sign of the wreck and it is no danger to navigation. The recommendation is for removal of the wreck from chart.

A tall structural tower of landmark value, inshore of Silver Strand Beach, Lat. 34° 09' 13.182" N, Lon. 119° 12' 56.352" W was located

using photo-location methods. The tower height, approximately 120 feet, was determined by visual observation (refer to "Separates," Form 76-40).

The large steel frame tower alongside wharf 4, in Port Hueneme, Lat. 34^0 09' 07.841" N, Lon. 119^0 12' 35.589" W, is of excellent landmark value. Adjacent to this large tower is a smaller steel frame tower, estimated to be seventy feet high. This smaller tower is not of landmark value (refer to "Separates," Form 76-40).

Rotten wood bulkheads exist at the north end of Port Hueneme, Lat. 34° 09' 10" N, Lon. 119° 12' 35" W. Many rusted bolts and nails extend from the wood. This wharf is a poor facility for mooring.

The pier faces of Wharves 1, 3, and 4 are approximately 15 feet high. They are constructed of wood and cement pilings.

The pipeline shown to be present on the beach south of Port Hueneme (refer to Master Field Edit Sheet) does not exist. This pipe was probably a part of dredging operations that were taking place at the time the photographs were taken. The recommendation is for removal of this feature from the manuscript.

Six small picnic areas each comprised of three rectangular groups of picnic tables are located in the vicinity of Lat. 34^{0} 08' 35" N, Lon. 119^{0} 11' 45" W. The ruins refered to on the Master Field Edit Sheet may have been the supplies necessary for construction of these Picnic areas. It is recommended that the picnic areas be charted.

TP-00779

Field Edit for this manuscript was begun and completed during November, 1976. Work was highly sectionalized due to the frequent inaccessability of the shoreline on the Pt. Mugu Pacific Missile Test Center. Field edit is complete and thorough for TP-00779.

All investigation for non-floating aids to navigation and landmarks for charts have been completed. One fixed aid and twelve landmarks are being submitted for charting purposes. Reference the Master Field Edit Sheet, "Separates Following the Text", Form 76-40, and Horizontal Control Report; OPR-411-RA-76 for further information. Questions, discrepancies, and notes to the field editor have been completely answered with proper cross-referencing.

Along the majority of the sand and gravel shoreline of this manuscript the MHWL shows a general shift seaward over the previously compiled MHWL. In several cases the MHWL is the seaward edge of the rock and riprap breakwater that comprises sections of the shoreline along the eastern portion of the Pt. Mugu Pacific Missile Test Center. In all other cases, the MHWL is believed by the field editor to be the interface between the light and dark sand along the shore. This interface

The location of the Aero Beacon requiring investigation is not in the vicinity of the shoreline as is noted on the manuscript. The beacon's actual location is further inshore, on a building complex near the airfield. Refer to the Master Field Edit Sheet and "Separates," Form 76-40 for further information.

The entire base area, which covers 90% of this manuscript is covered with marsh and scrub lands. The missile complexes, tracking facilities, and other installations are located throughout the marsh and brushlands on concrete and gravel pads that have been built up for these facilities. Descriptive notes pertaining to the marshland features and their boundaries have been made on the Master Field Edit Sheet and corresponding cronapaque photographs. Refer to them for more complete information.

The object located off the western tip of the entrance to Mugu Lagoon is the ribbing of a small wreck. It was positioned by two fixes during hydrographic survey operations. Refer to DESCRIPTIVE REPORT; H-9667 for further information. The recommendation is that it be charted as described in the previously mentioned report.

The entrance to Mugu Lagoon is shallow and dangerous due to shifting sand bars and heavy surf off the mouth. Transit should be attempted only at high tide and with low surf. The lagoon itself shows little change though some drying of the surrounding marshes was noted during field edit. Small boats can be operated within the lagoon. The lagoon should be charted as compiled on the manuscript.

TP-00780; 1:10,000

Field edit for this manuscript was begun in early November, 1976 and completed by early December, 1976. Work began at the southeast manuscript limit and progressed northwest to the junction with TP-00779. Field edit is complete and thorough for TP-00780.

All investigations for non-floating aids to navigation and landmarks for charts have been completed for this manuscript. Seven landmarks are being submitted for charting purposes. Refer to the Haster Field Edit. Sheet, "Separates Following the Text", Form 76-40, and Horizontal Control Report; OPR-411-RA-76 for further information. Questions, discrepancies, and notes to the field editor have been completely answered with proper cross referencing.

The extent of Mugu Lagoon on this manuscript shows little variation

from that previously compiled. There is some drying of the surrounding marshlands but it is not extensive. The recommendation is that the lagoon be charted as previously compiled.

The region centered around the following position: 34° 05′ 30″ N, 119° 04′ 00″ W is the rifle range for the Pt. Mugu Pacific Missile Test Center. The region seaward of the cement backstop with sand buildup is dangerous due to the possibility of stray bullets. Seaward of the quonset hut that serves as the headquarters is a large sign that reads "DANGER LIVE FIRE". This sign is visible from the nearby waters, and it is recommended that it be charted for completeness.

The rock ledge shoreline compiled from Pt. Mugu east around a small cove to the next point in actuality exists only around Pt. Mugu.

East of this point the shoreline is characterized by smaller rocks, sand, and gravel. There are numerous rocks baring, awash, and submerged off each point. All is noted on the Master Field Edit Sheet and referenced to the appropriate cronapaque photographs. Refer to them for more complete information.

The massive sand buildup, centered at the following position; 34° 04.5' N x 119° 01.2' W, exists and is visually prominent from seaward. Its area is too large to give one precise geographic position. The term "SLIDE" used on the office compiled manuscript does not seem to be correct in describing the actual physical setting. The sand buildup appears to be caused by the depositing of the sand against the rock outcrops and bluff behind and above, by winds from off the ocean. It is recommended that this feature be charted as compiled on the final manuscript, and that the name of the feature be changed to "PROMINENT SAND DUNE".

The small building-like structure located at position; 34° 04′ 19″ N x 119° 00′ 49″ W is in actuality an abandoned bridge. It is partially overgrown with scrub growth and run over a now dried creek bed that appears to be used as a hiking trail. This area on both sides of the Pacific Coast Highway is a park complex. Five permanent buildings are noted on the manuscript and are recommended for charting, along with the previously mentioned features noted on the Master Field Edit Sheet.

Two submerged rocks are compiled at the following positions:

$$34^{\circ}$$
 04' 15" N x 119° 01' 00" W 34° 04' 02" N x 119° 00' 37" W

Neither of the rocks were visible on the photographs nor were they seen upon inspection of their surroundings from shore. This region is out of the area for RAINIER hydrographic survey operations as defined by PROJECT INSTRUCTIONS; OPR-411-RA-76. Information on soundings and possible dangers to navigation in this area should be contained in the

records for survey operations by the NOAA Ship FAIRWEATHER, FA-10-5-76, H-9600, OPR-411-FA-76. It is recommended that their records be consulted.

Photo Identified Signals

As an integral part of Field edit operations for JOB CM-7404, Manuscript TP-00778, scale 1:5000, signals for hydrographic survey operations were identified and photogrametrically located. The area covered encompasses Port Hueneme and Channel Islands Harbor, the area covered by hydrographic survey RA-5-3-76, H-9666, OPR-411-RA-76. A separate photo signal film ozalid for manuscript TP-00778 is being submitted as a part of the field edit data package. Annotated by every signal on the ozalid are the corresponding number on the Master Station List and the photograph number for each ray used in positioning. Photographs were chosen to provide the best possible intersection for at least 3 positioning rays for every signal. Field computations for each photo identified signal are contained in the PHOTO SIGNAL COMPUTATIONS section of the "Separates Following the Text". Information is included such as: The meters forward and backward that were scaled, conversion to seconds, forward and backward latitude and longitude computations, and the final geographic position computation taken from the mean of the forward and backward positions. The photo Signal Film Ozalid plus Photo Signal Computations contains all necessary information for the verification of photogrametrically located signals. Reference the "Separates," Master Station List and Photo Signal Computations for further information.

Additional Information

RAINIER personnel obtained numerous geographic positions and geodetic information in order to expand the control networks for hydrographic survey operations and for location of fixed aids to navigation and objects of landmark value from the following source:

PT. MUGU PACIFIC MISSILE TEST CENTER GEOPHYSICS BRANCH GEODESY GROUP c/o MR. WARREN KLEMZ

Employees of this group have had previous experience in, and/or dealings with, the National Geodetic Survey, and all geodetic position information supplied by them meets or exceeds N.O.S., N.G.S. Third Order, Class I standards for accuracy. It is recommended that all geodetic information obtained from PT. MUGU, PMTC, GEOPHYSICS BRANCH, GEODESY GROUP that was used to assist and suppliment RAINIER Horizontal Control operations be accepted as conforming to N.O.S. standards. Further, it is recommended that all non-floating aids to navigation and landmarks for charts positioned by information obtained from this group be accepted for charting purposes. Refer to HORIZONTAL CONTROL REPORT; OPR-411-RA-76 for further information.

Recommendations

Various recommendations are contained in previous sections of the text. No further recommendations deemed necessary.

Respectfully Submitted,

JOHN C. OSBORN JR. LTJG, NOAA

To charts ,

						i			
NOAA FORM 7640 (8-74)	40		TAN	TIONAL OCE	ANIC AND A	S. DEPARTM Atmospher	U.S. DEPARTMENT OF COMMERCE NATIONAL OCEANIC AND ATMOSPHERIC ADMINISTRATION	ORIGINATING ACTIVITY	CTIVITY
Replaces C&GS Form 567	Form 567.	LANG	OMARKS	LANDWARKS FOR CHARTS	RTS			GEODETIC PARTY	- :
THE CALL	Ī	STATE		LOCALITY			DATE	COMBINATION ACTIVITY	>
TO BE REVISED	ISED (Costal Manning Division			Point	Vicente	to		FINAL REVIEWER	
TO BE DELETED	-	California	nta	Porter	PorteHueneme		6/21/77	CONTROL & REVIEW GREY	CH PV FF ST LOZ
The following objects	ΞŢ	been inspected from seaward to determine their value as landmarks	ward to de	termine the	ir value as	landmarks.		(See reverse for responsible personnel)	ble personnel)
מין אין				7001 AN					
OPR-411	QM-7404	TP-00780			NO		(See instructions on reverse side)	on reverse side)	CHARTS
	DESCRIPTION	NO	LATITUDE	LUDE	LONGITUDE	rude			AFFECTED
CHARTING	(Record reason for deletion of landmark or aid to navigation. Show triangulation station names, where applicable, in perentheses)	ark or aid to navigation. ere applicable, in perentheses)	, ,	// D.M.Meters	/ 0	// D.P. Meters	OFFICE	FIELD	•
21.10	Prominent Slide (Sand)	(34 04:		10 611		74L(I)1597	ŚΪΛ÷Λ	18720
STIDE	(Too large to position	n accurately)					3/21/74	11/30/76	
				39,40		35.04	74L(1)2235	V-VIS	-
TANKS	Westerly of two		34 06	1213.9	119 04	898.3	4/5/74	11/30/76	
ANTENNA	Lacuna neals command	Dist. antenna		27.256		53.053		Pos. obtained	=
		- }	34 06	839,78	119 03	1360.01		geophyscis Branch	
TOWER	T.D.T.S. Tower on Peak		34 06	31,655	119 03	53.286		t	=
	12.07			975,32		1365.99		**	
DISH			34 06	30,312	119 03	49.559			=
ANTENNA	to root dish, Largest	and highest		933,94		1270,45			
ANTENNA		smaller and set	34 06	26.707	119 03	56,663		•	=
	lowertoon peak than con	command -Dist.		822.87		1452.56			
	4		34 05	29,393	119 03	56.29	74L(1)1600	LP5	<u> </u>
TOWER	Lookout tower for rifle	le range	•	905.62		1443.28	3/21/71	11/30/76	
			•		•				
			·					ļ	
								-	

	RESPONSIBLE PERSONNEL	
TYPE OF ACTION	ZAXE	ORIGINATOR
		PHOTO FIELD PARTY X HYDROGRAPHIC PARTY
OBJECTS INSPECTED FROM SEAWARD	J. C. Osborn Lt. JG NOAA	GEODETIC PARTY OTHER (Specify)
POSITIONS DETERMINED AND/OR VERIFIED	c.	FIELD ACTIVITY REPRESENTATIVE
	L. O. Neterer Jr. Cartographer	OFFICE ACTIVITY REPRESENTATIVE
FORMS ORIGINATED BY QUALITY CONTROL AND REVIEW GROUP AND FINAL REVIEW		OHALITY CONTROL AND BEVIEW CROLLS
ACTIVITIES		REPRESENTATIVE
IN:	INSTRUCTIONS FOR ENTRIES UNDER 'METHOD AND DATE O (Consult Photogrammetric Instructions No. 64,	DATE OF LOCATION' s No. 64,
OFFICE IDENTIFIED AND LOCATED OBJECTS	FIELD ((Cont'd) Photogrammetric field positions** require
Enter the number and date (including month, day, and year) of the photograph used to identify and locate the bject. EXAMPLE: 75E(C)6042 8-12-75	to	
I. NEW POSITION DETERMINED OR VERIFIED Enter the applicable data by symbols F - Field P - Photogrammet L - Located Vis - Visually V - Verified	s as follows:	TRIANGULATION STATION RECOVERED When a landmark or aid which is also a tri-angulation station is recovered, enter 'Triang. Rec.' with date of recovery. EXAMPLE: Triang. Rec.
ation 5 -	Field identified Theodolite	8-12-75
tion 7 -	ble III.	POSITION VERIFIED VISUALLY ON PHOTOGRAPH
on sitions*	of method of	Enter 'V+Vis.' and date. EXAMPLE: V-Vis. 8-12-75
EXAMPLE: F-2-6-L 8-12-75	**PHOTOGRAMMETR	RAMMETRIC FIELD POSITIONS are dependent ly, or in part, upon control established
*FIELD POSITIONS are determined by field obser- vations based entirely upon ground survey methods.		netr

SUPERSEDES NOAA FORM 76-40 (2-71) WHICH IS OBSOLETE, AND EXISTING STOCK SHOULD BE DESTROYED UPON RECEIPT OF REVISION.

NOAA FORM 76-40 (8-74)

☆ U.S. GOVERNMENT PRINTING OFFICE: 1974-665-073/1030 Region 6

REVIEW REPORT

TP-00780 SHORELINE

March 1, 1979

61. GENERAL STATEMENT:

See Summary, page 6 of this Descriptive Report.

Changes to the mean high water line recommended by the field editor are not considered "extensive" and were ignored. The mean high water line shown on the map was delineated from tide coordinated infrared photographs and is correct as of the date of photography.

Several bluffs recommended for charting by the field editor were not delineated on the map. They are not discernible on the photographs and the field editor failed to provide the limits.

62. COMPARISON WITH REGISTERED TOPOGRAPHIC SURVEYS:

Comparison was made with a copy of T-4816 and T-4832 each 1:10,000 scale dated 1932 and 1933 respectively.

Retaining walls shown on T-4832 at long. $119^{0}00.3$ ' are not visible on the photographs and are not shown on TP-00780. The shoreline in Mugu Lagoon has experienced significant change. Bluffs shown on T-4816 between La Jolla Canyon and Point Mugu are not discernible on the photography and are not shown on TP-00780. TP-00780 supersedes T-4816 and T-4832 for chart construction purposes.

63. COMPARISON WITH MAPS OF OTHER AGENCIES:

Comparison was made with USGS Quadrangle Point Mugu, California, 1:24,000 scale, dated 1949 photorevised 1967. There are no significant differences.

64. COMPARISON WITH CONTEMPORARY HYDROGRAPHIC SURVEYS:

Comparison was made with a copy of Final Verified Smooth Sheet H-9600 (FA-10-5-76) and H-9667 (RA-20-6-76). There are no significant differences.

65. COMPARISON WITH NAUTICAL CHARTS:

Comparison was made with Chart 18740, 1:234,270 scale; 19th edition, dated September 28, 1974. There are no significant differences.

66. ADEQUACY OF RESULTS AND FUTURE SURVEYS:

This map complies with the project instructions and meets the requirements for Bureau Standards and the National Standards of Map Accuracy.

Submitted by:

A. L. Shands

Final Reviewer

a.L. Shands

Approved for forwarding:

albet C. Rauch J.

Chief, Photogrammetric Branch, AMC

John D Perraw In

Ohief, Photogrammetric Branch

Chief, Coastal Mapping Division

PROJECT CM-7404 MATERIALS ON FILE

FEDERAL RECORDS CENTER

Control Station Identification Cards Field Edit Photographs Bridging Photographs Job Completion Report

BUREAU ARCHIVES

Registered Copy of Each Map Descriptive Report of Each Map

GEODESY

Geodetic Records

MARINE CHART DIVISION

Chart Maintenance Print for Each Map Forms 76-40

OFFICE OF GEOGRAPHER

Geographic Names Standards

REPRODUCTION DIVISION

Film Copy of Each Map

NAUTICAL CHART DIVISION

RECORD OF APPLICATION TO CHARTS

FILE WITH DESCRIPTIVE REPORT OF SURVEY NO.

INSTRUCTIONS

- A basic hydrographic or topographic survey supersedes all information of like nature on the uncorrected chart.

- Letter all information.
 In "Remarks" column cross out words that do not apply.
 Give reasons for deviations, if any, from recommendations made under "Comparison with Charts" in the Review.

CHART	DATE	CARTOGRAPHER	REMARKS
18740	1-10-80	5 m. 7120	Full Part Before After Verification Review Inspection Signed Via
			Drawing No. 45 As Corr
			Full Part Before After Verification Review Inspection Signed Via
			Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.
			Full Part Before After Verification Review Inspection Signed Via
			Drawing No.
	· · · · · · · · · · · · · · · · · · ·		Full Part Before After Verification Review Inspection Signed Via
			Drawing No.
			Full Part Before After Verification Review Inspection Signed Via
			Drawing No.
			Full Part Before After Verification Review Inspection Signed Via
			Drawing No.
	<u> </u>		Full Part Before After Verification Review Inspection Signed Via
			Drawing No.
			Full Part Before After Verification Review Inspection Signed Via
			Drawing No.
			Full Part Before After Verification Review Inspection Signed Via Drawing No.